

PROVU™ PD7000 Temperature Meter

Instruction Manual



PROVU
SERIES



MeterView Pro

USB Install

- 1/8 DIN Digital Panel Temperature Meter with NEMA 4X, IP65 Front
- J, K, T, E, R, S, B, N, C Thermocouples
- 100 or 1000 Ω Platinum, 10 Ω Copper, 120 Ω Nickel RTDs
- Optional Isolated 4-20 mA Output Turns the Meter into a Temperature Transmitter
- 1° or 0.1° Resolution
- Averages up to 10 RTD Sensors
- Automatic Cold Junction Compensation
- Dual-Line 6-Digit Display, 0.6" (15 mm) & 0.46" (12 mm)
- 2 or 4 Relays with Interlocking Capability + Isolated 4-20 mA Output Options
- Free PC-Based, Onboard, MeterView Pro USB Programming Software
- No Assembly Required
- Optional SunBright Display Models for Outdoor Applications
- Operating Temperature Range: -20 to 65°C (-4 to 149°F)
- UL & C-UL Listed. E160849; 508 Industrial Control Equipment
- Input Power Options: 85-265 VAC / 90-265 VDC or 12-24 VDC / 12-24 VAC
- Programmable Display, Function Keys & Digital Input
- External 4-Relay & Digital I/O Expansion Modules
- RS-232 & RS-485 Serial Communication Options with Modbus RTU
- Password Protection
- Wide Assortment of NEMA 4X Enclosures for up to Ten Meters
- Light / Horn & Reset Button Accessory
- Control Station Accessory for Remote Operation of PROVU
- 3-Year Warranty

PRECISION DIGITAL CORPORATION

233 South Street • Hopkinton MA 01748 USA
Tel (800) 343-1001 • Fax (508) 655-8990

www.predig.com

**PRECISION
DIGITAL**

Disclaimer

The information contained in this document is subject to change without notice. Precision Digital makes no representations or warranties with respect to the contents hereof and specifically disclaims any implied warranties of merchantability or fitness for a particular purpose. See Warranty Information and Terms & Conditions on www.predig.com for complete details.

CAUTION

- Read complete instructions prior to installation and operation of the meter.

WARNINGS

- Risk of electric shock or personal injury.
- This product is not recommended for life support applications or applications where malfunctioning could result in personal injury or property loss. Anyone using this product for such applications does so at his/her own risk. Precision Digital Corporation shall not be held liable for damages resulting from such improper use.

WARNING
Cancer and Reproductive Harm - www.P65Warnings.ca.gov

Limited Warranty

Precision Digital Corporation warrants this product against defects in material or workmanship for the specified period under "Specifications" from the date of shipment from the factory. Precision Digital's liability under this limited warranty shall not exceed the purchase value, repair, or replacement of the defective unit. See Warranty Information and Terms & Conditions on www.predig.com for complete details.

Registered Trademarks

All trademarks mentioned in this document are the property of their respective owners.

© 2020 Precision Digital Corporation.
All rights reserved.

FREE MeterView Pro Programming Software



*The meter can be powered from the Micro USB connection. When using the Micro USB connection, **DO NOT** apply AC or DC power to the meter.*

The easiest and quickest way to program your PROVu meter is to use the FREE MeterView Pro programming software. This software is loaded into the meter and connects and installs directly to your PC with a USB cable. We recommend that the first thing you do after taking the meter out of the box is connect the PROVu to your PC with the provided USB cable – do not use a different cable. **DO NOT** apply AC or DC power to the meter while your PC is connected to the meter as it will disrupt the USB connection. You don't even have to apply an input signal.

MeterView Pro programming software is intuitive, and most customers can get their meter programmed as they like without even looking in the manual.

Watch MeterView Pro Software Video at www.predig.com/meterviewpro

In addition to programming, the software may be used for:

- Monitoring
- Datalogging using your PC
- Generating and saving programming files for later use

Once your meter is programmed the way you want it, you can wire it up for your application per the instructions in this manual and install it. If you find that you need to make adjustments to the programming after the meter is installed, you can use the front panel buttons and the instructions in this manual to do so.

Table of Contents

| | |
|--|----|
| Introduction | 6 |
| Ordering Information | 6 |
| Specifications..... | 7 |
| General | 7 |
| Temperature Input | 8 |
| Relays | 8 |
| Isolated 4-20 mA Output | 9 |
| USB Connection | 9 |
| On-Board Digital Input (F4)..... | 9 |
| Modbus® RTU Serial Communications..... | 9 |
| MeterView Pro..... | 9 |
| Compliance Information..... | 10 |
| Safety | 10 |
| Electromagnetic Compatibility | 10 |
| Safety Information | 10 |
| Installation | 10 |
| Unpacking | 10 |
| Panel Mounting Instructions | 11 |
| Mounting Dimensions..... | 11 |
| Installation Overview..... | 12 |
| MeterView Pro Software..... | 12 |
| MeterView Pro Installation..... | 12 |
| Connections | 13 |
| Connectors Labeling | 13 |
| Power Connections | 13 |
| Signal Connections | 14 |
| Connections for Averaging RTD Sensors | 14 |
| Modbus RTU Serial Communications | 14 |
| Relay Connections | 15 |
| Switching Inductive Loads..... | 15 |
| F4 Digital Input Connections | 15 |
| 4-20 mA Output Connections | 15 |
| Analog Output Power Supply | 15 |
| External Relays & Digital I/O Connections | 16 |
| Interlock Relay Feature | 16 |
| Setup and Programming | 17 |
| Front Panel Buttons and Status LED Indicators | 17 |
| Display Functions & Messages..... | 18 |
| Main Menu | 19 |
| Setting Numeric Values | 20 |
| Setting Up the Meter (SEtUP) | 20 |
| Setting the Input Signal (InPUt)..... | 20 |
| Selecting the Temperature Scale (F or C)..... | 20 |
| Setting the Decimal Point (dEc Pt)..... | 20 |
| Setting the Display Parameter & Intensity (dSPLRy) | 21 |
| Display Intensity (d-IntY)..... | 21 |
| Setting the Display Units or Custom Tags (unItS) | 21 |
| Setting the Relay Operation (rELRY)..... | 22 |
| Setting the Relay Action..... | 22 |
| Programming Set and Reset Points | 23 |
| Setting Fail-Safe Operation | 23 |
| Programming Time Delay..... | 23 |
| Relay Action for Loss of Input (Input Break)..... | 23 |
| Relay and Alarm Operation Diagrams | 23 |
| High Alarm Operation (Set > Reset) | 23 |
| Low Alarm Operation (Set < Reset) | 23 |
| High Alarm with Fail-Safe Operation (Set > Reset)..... | 24 |
| Low Alarm with Fail-Safe Operation (Set < Reset) | 24 |
| Relay Sampling Operation | 24 |
| Signal Loss or Input Break Relay Operation | 24 |

- Time Delay Operation25
- Relay Operation Details25**
 - Overview25
 - Relays Auto Initialization25
 - Fail-Safe Operation25
 - Front Panel LEDs26
 - Latching and Non-Latching Relay Operation26
 - Non-Latching Relay (Rst)26
 - Non-Latching Relay with Manual Reset (R-nRn)26
 - Latching Relay (Lst)26
 - Latching Relay with Clear (L-C)27
 - Acknowledging Relays27
 - Setting Up the Interlock Relay (Force On) Feature27
- Scaling the 4-20 mA Analog Output (Rout)28**
- Reset Menu (rESEt)28**
- Manual Control Menu (Control)28**
- Setting Up the Password (PR55)29**
 - Protecting or Locking the Meter29
 - Making Changes to a Password Protected Meter29
 - Disabling Password Protection29
- Advanced Features Menu30**
 - Advanced Features Menu & Display Messages30
 - Offset Adjust (Adj)31
 - Recalibration of the Meter (t RL)31
 - Noise Filter (FiltEr)31
 - Noise Filter Bypass (bYP55)32
 - Rounding Feature (round)32
 - Modbus RTU Serial Communications (SEr RL)32
 - Select Menu (SELEct)32
 - Analog Output Programming (RoutPr)32
 - Programmable Function Keys User Menu (u5Er)33
 - Internal Temperature Calibration (iRL)34
- Meter Operation35**
 - Front Panel Buttons Operation35**
 - Function Keys Operation35**
 - F4 Operation35**
 - Maximum/Minimum Readings35**
- Troubleshooting36**
 - Diagnostics Menu (d RL)36**
 - Determining Software Version36
 - Reset Meter to Factory Defaults36**
 - Factory Defaults & User Settings37
 - Troubleshooting Tips38**
- EU Declaration of Conformity39**


Table of Figures

| | |
|---|----|
| Figure 1: 1/8 DIN Panel Cutout and Mounting..... | 11 |
| Figure 2. Meter Dimensions - Side View | 11 |
| Figure 3. Meter Dimensions - Top View | 11 |
| Figure 4. PD7000-##0 Connectors Label | 13 |
| Figure 5. PD7000-##2 Connectors Label | 13 |
| Figure 6. PD7000-##3 Connectors Label | 13 |
| Figure 7. PD7000-##4 Connectors Label | 13 |
| Figure 8. PD7000-##5 Connectors Label | 13 |
| Figure 9. PD7000-##7 Connectors Label | 13 |
| Figure 10. Power Connections | 13 |
| Figure 11. Thermocouple Input Connections..... | 14 |
| Figure 12. Three-Wire RTD Input Connections | 14 |
| Figure 13. Two-Wire RTD Input Connections..... | 14 |
| Figure 14. Four-Wire RTD Input Connections..... | 14 |
| Figure 15. Average Temperature RTD Input Connections | 14 |
| Figure 16. Relay Connections..... | 15 |
| Figure 17. AC and DC Loads Protection..... | 15 |
| Figure 18. Low Voltage DC Loads Protection | 15 |
| Figure 19. F4 Digital Input Connections | 15 |
| Figure 20. 4-20 mA Output Connections | 15 |
| Figure 21. Analog Output Supply Powering Other Devices..... | 15 |
| Figure 22. Expansion Module & DIN Rail Mounting Kit..... | 16 |
| Figure 23. External Relays Module Connections..... | 16 |
| Figure 24. Digital I/O Module Connections..... | 16 |
| Figure 25. Interlock Connections | 16 |

Introduction

The ProVu PD7000 temperature meter accepts a direct temperature input from a wide range of temperature measurement devices (type J, K, T, E, R, S, B, N, and C thermocouples and 100 or 1000 Ω platinum, 10 Ω copper, 120 Ω nickel RTDs). It displays the measured temperature in either degrees Fahrenheit or degrees Celsius on a dual-line, 6-digit display. The display features superluminous LED digits that make it easily readable in smoke, dust, fog, and, with the optional SunBright display, even direct sunlight.

The PD7000 can be equipped with an optional 4-20 mA output that turns a temperature meter into an isolated temperature transmitter with a big, bright display!

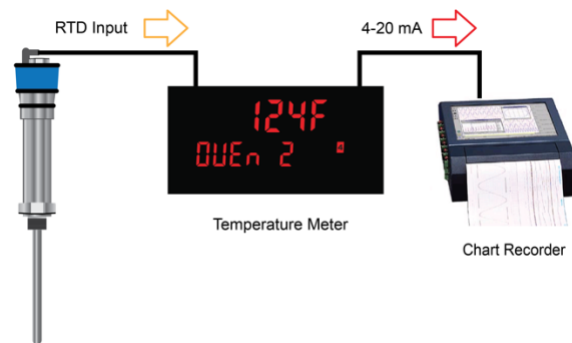

The PD7000 includes automatic cold junction compensation for thermocouples and the ability to average up to ten (10) RTD sensors.

A fully loaded PD7000 meter has the following: four SPDT relays, 4-20 mA output, and one 24 VDC power supply to power the 4-20 mA output. The PD7000 capabilities may be enhanced by adding the following external expansion modules: four SPST relays (creating an eight-relay temperature meter), two digital I/O modules with four inputs and four outputs each, and USB, RS-232 or RS-485 communication adapters. A digital input is standard.

The eight relays can be used for alarm indication or on/off temperature control applications. The 4-20 mA isolated output, Modbus RTU serial communications, and digital I/O options make the PD7000 an excellent addition to any system.

Ordering Information

Standard Models

| 85-265 VAC Model | 12-24 VDC Model | Options Installed |
|------------------|-----------------|---------------------------|
| PD7000-6R0 | PD7000-7R0 | No options |
| PD7000-6R2 | PD7000-7R2 | 2 relays |
| PD7000-6R3 | PD7000-7R3 | 4-20 mA output |
| PD7000-6R4 | PD7000-7R4 | 4 relays |
| PD7000-6R5 | PD7000-7R5 | 2 relays & 4-20 mA output |
| PD7000-6R7 | PD7000-7R7 | 4 relays & 4-20 mA output |

SunBright Display Models

| 85-265 VAC Model | 12-24 VDC Model | Options Installed |
|------------------|-----------------|---------------------------|
| PD7000-6H0 | PD7000-7H0 | No options |
| PD7000-6H2 | PD7000-7H2 | 2 relays |
| PD7000-6H3 | PD7000-7H3 | 4-20 mA output |
| PD7000-6H4 | PD7000-7H4 | 4 relays |
| PD7000-6H5 | PD7000-7H5 | 2 relays & 4-20 mA output |
| PD7000-6H7 | PD7000-7H7 | 4 relays & 4-20 mA output |

Accessories

| Model | Description |
|---------------------------|---|
| PDA1002 | DIN rail mounting kit for two devices |
| PDA1004 | 4 SPST (Form A) relays module |
| PDA1044 | 4 digital inputs & 4 digital outputs module |
| PDA1232 | RS-232 serial adapter |
| PDA1485 | RS-485 serial adapter |
| PDA7485-I | RS-232 to RS-485 isolated converter |
| PDA8008 | USB Adapter |
| PDA8232-N | USB to RS-232 non-isolated converter |
| PDA8485-I | USB to RS-485 isolated converter |
| PDA-LH | Light / horn accessory |
| MOD-LH | Light / horn / enclosure modification |
| PDA2360 | Plastic control stations series |
| PD659 | Signal isolators, splitters, & conditioners |
| PD9501 | Multi-function calibrator |
| PDX6901 | Snubber: 0.01 μF/470 Ω, 250 VAC |

Enclosures

| Series | Meters | Material |
|-------------------------|--------|-------------------------|
| PDA2300 | 1-10 | Plastic NEMA 4X |
| PDA2500 | 1-6 | Plastic NEMA 4X |
| PDA2600 | 1-6 | Stainless Steel NEMA 4X |
| PDA2700 | 1-6 | Painted Steel NEMA 4 |
| PDA2800 | 1-2 | Plastic NEMA 4X |
| PDA3400 | 1-3 | Plastic NEMA 4X |

Need help selecting the right enclosure?
Go to www.predig.com/esu

Replacement Option Cards

| Model | Options Installed |
|------------------------|---------------------------|
| PD1102 | 2 relays |
| PD1103 | 4-20 mA output |
| PD1104 | 4 relays |
| PD1105 | 2 relays & 4-20 mA output |
| PD1107 | 4 relays & 4-20 mA output |

Specifications

Except where noted all specifications apply to operation at +25°C.

General

| | |
|------------------------------|---|
| Display | Line 1: 0.60" (15 mm) high red LEDs; Line 2: 0.46" (12 mm) high red LEDs. Both displays have six characters with leading zero blanking. Temperature displayed on line 1 with four or five-digits and F/C indication, based on configuration. Example 234 12F with 0.1° resolution and 234 12F with 1° resolution. |
| Resolution | 1° or 0.1° for all thermocouple and RTD inputs |
| Display Intensity | Eight user selectable intensity levels |
| Display Update Rate | 5/second (200 ms) |
| Overrange | Display flashes 99999 |
| Underrange | Display flashes -9999 |
| Programming Methods | Four front panel buttons, digital inputs, PC and MeterView Pro software, or Modbus registers. |
| Noise Filter | Programmable from 2 to 199 (0 will disable filter) |
| Filter Bypass | Programmable from 0.1 to 99.9% of calibrated span |
| Recalibration | All ranges are calibrated at the factory. Recalibration is recommended at least every 12 months. |
| Max/Min Display | Max/min readings reached by the process are stored until reset by the user or until power to the meter is cycled. |
| Rounding | Select 1, 2, 5, 10, 20, 50, or 100 (e.g. rounding = 10, value = 123.45, display = 123.50). |
| Password | Three programmable passwords restrict modification of programmed settings. Pass 1: Allows use of function keys and digital inputs Pass 2: Allows use of function keys, digital inputs and editing set/reset points Pass 3: Restricts all programming, function keys, and digital inputs. |
| Non-Volatile Memory | All programmed settings are stored in non-volatile memory for a minimum of ten years if power is lost. |
| Power Options | 85-265 VAC 50/60 Hz; 90-265 VDC, 20 W max; 12-24 VDC, 12-24 VAC, 15 W max. Powered over USB for configuration only. |
| Fuse | Required external fuse: UL Recognized, 5 A max, slow blow; up to 6 meters may share one 5 A fuse |
| Normal Mode Rejection | Greater than 60 dB at 50/60 Hz |
| Isolation | 4 kV input/output-to-power line 500 V input-to-output |
| Overvoltage Category | Installation Overvoltage Category II: Local level with smaller transient overvoltages than Installation Overvoltage Category III. |

| | |
|---------------------------|---|
| Environmental | Operating temperature range: -20 to 65°C (-4 to 149°F) Storage temperature range: -40 to 85°C (-40 to 185°F) Relative humidity: 0 to 90% non-condensing |
| Connections | Removable screw terminal blocks accept 12 to 22 AWG wire, RJ45 for external relays, digital I/O, and serial communication adapters. |
| Enclosure | 1/8 DIN, high impact plastic, UL 94V-0, color: black |
| Front Panel | NEMA 4X, IP65 |
| Mounting | 1/8 DIN panel cutout required: 3.622" x 1.772" (92 mm x 45 mm) Two panel mounting bracket assemblies are provided. |
| Tightening Torque | Screw terminal connectors: 5 lb-in (0.56 Nm) |
| Overall Dimensions | 4.68" x 2.45" x 5.64" (119 mm x 62 mm x 143 mm) (W x H x D) |
| Weight | 9.5 oz (269 g) |
| Warranty | 3 years parts & labor. See Warranty Information and Terms & Conditions on www.predig.com for complete details. |

Temperature Input

| | |
|--------------------------------|---|
| Inputs | Thermocouple: J, K, T, E, R, S, B, N, C RTD: 100 Ω platinum (0.00385 & 0.00392 coefficients), 10 Ω copper, 120 Ω nickel, 1000 Ω platinum (0.00385 & 0.00392 coefficients) |
| Cold Junction Reference | Automatic, fixed, no user calibration needed |
| Temperature Drift | ±2°C maximum from 0 to 65°C ambient temperature ±4°C maximum from -20 to 0°C ambient temperature |
| Offset Adjustment | User programmable offset adjust ±50.0 degrees. This parameter allows the user to apply an offset value to the temperature being displayed. |
| Input Impedance | Greater than 100 kΩ |
| Sensor Break Detection | Open TC or RTD sensor indicated by display flashing $\sigma P E n$, relays can be programmed to go "On", "Off", or to "Ignore" (Note: Ignore is detected as an upscale condition). Analog output goes to the programmed sensor break value. |
| RTD Averaging | Up to 10 RTDs connected in parallel can be averaged. |

Accuracy & Ranges

| Type | Range (°F) | Accuracy | Range (°C) | Accuracy |
|-------|--------------|----------|--------------|----------|
| J | -200 to 2000 | ±1.8°F | -129 to 1093 | ±1°C |
| K | -200 to 2400 | ±1.8°F | -129 to 1316 | ±1°C |
| T | -200 to 752 | ±1.8°F | -129 to 400 | ±1°C |
| E | -200 to 1800 | ±1.8°F | -129 to 982 | ±1°C |
| R | -50 to 3000 | ±3.6°F | -46 to 1649 | ±2°C |
| S | -50 to 3000 | ±3.6°F | -46 to 1649 | ±2°C |
| B | 752 to 3300 | ±3.6°F | 400 to 1816 | ±2°C |
| N | -100 to 2300 | ±3.6°F | -73 to 1260 | ±2°C |
| C | 32 to 4100 | ±3.6°F | 0 to 2260 | ±2°C |
| 10Ω | -328 to 500 | ±0.2°F | -200 to 260 | ±0.1°C |
| 100Ω | -328 to 1562 | ±0.7°F | -200 to 850 | ±0.4°C |
| 120Ω | -110 to 500 | ±0.2°F | -79 to 260 | ±0.1°C |
| 1000Ω | -328 to 900 | ±0.7°F | -200 to 482 | ±0.4°C |

All ranges capable of 1° or 0.1° resolution.

Relays

| | |
|----------------------------|---|
| Rating | 2 or 4 SPDT (Form C) internal and/or 4 SPST (Form A) external; rated 3 A @ 30 VDC and 125/250 VAC resistive load; 1/14 HP (≈ 50 W) @ 125/250 VAC for inductive loads |
| Noise Suppression | Noise suppression is recommended for each relay contact switching inductive loads. See <i>Switching Inductive Loads</i> on page 15 for details. |
| Deadband | 0-100% of span, user programmable |
| High or Low Alarm | User may program any alarm for high or low trip point. Unused alarm LEDs and relays may be disabled (turn off). |
| Relay Operation | <ul style="list-style-type: none"> Automatic (non-latching) and/or manual reset Latching (requires manual acknowledge) with or without clear Pump alternation control (2-8 relays) Sampling (based on set point and time) Off (disable unused relays and enable Interlock feature) Manual on/off control mode |
| Relay Reset | User selectable via front panel button, F4 terminal at back of meter, external contact closure on digital inputs, or through serial communications. |
| Time Delay | 0 to 999.9 seconds, on & off relay time delays. Programmable and independent for each relay |
| Fail-Safe Operation | Programmable and independent for each relay. <i>Note: Relay coil is energized in non-alarm condition. In case of power failure, relay will go to alarm state.</i> |
| Auto Initialization | When power is applied to the meter, relays will reflect the state of the input to the meter. |
| Additional Relays | An external module, model PDA1004 , is available to add 4 SPST 3 A relays to the meter. |

Isolated 4-20 mA Output

| | | | |
|--|--|---------|---------|
| Output Source | PV (temperature), max, min, set points 1-8, Modbus PV input, or manual control mode | | |
| Scaling Range | 1.000 to 23.000 mA for any display range | | |
| Calibration | Factory calibrated: 0.0 to 2000.0 = 4-20 mA output | | |
| Analog Output Programming | 23.000 mA maximum for all parameters: Overrange, underrange, max, min, and break | | |
| Accuracy | ± 0.1% of span ± 0.004 mA | | |
| Temperature Drift | 0.4 µA/°C max from 0 to 65°C ambient, 0.8 µA/°C max from -20 to 0°C ambient <i>Note: Analog output drift is separate from input drift.</i> | | |
| Power Supply for Analog Output Loop Or Other Uses | Terminals I+ & R: 24 VDC ± 10%. May be used to power the 4-20 mA output or other devices. All models rated @ 40 mA max. | | |
| External Loop Power Supply | 35 VDC maximum | | |
| Output Loop Resistance | Power supply | Minimum | Maximum |
| | 24 VDC | 10 Ω | 700 Ω |
| | 35 VDC (external) | 100 Ω | 1200 Ω |
| Additional 4-20 mA Outputs | The PD659-1MA-2MA can split the optional 4-20 mA output into two isolated 4-20 mA outputs | | |
| 0-10 VDC Output | The PD659-1MA-1V can convert the optional 4-20 mA output to a 0-10 VDC output | | |

USB Connection

| | |
|-----------------------|--|
| Function | Programming only |
| Compatibility | USB 2.0 Standard, Compliant |
| Connector Type | Micro-B receptacle |
| Cable | USB A Male to Micro-B Cable |
| Driver | Microsoft® Windows® XP/Vista/7/8/10 |
| Power | USB port provides power to the meter. DO NOT apply AC or DC power to the meter while the USB port is in use. |

On-Board Digital Input (F4)

| | |
|-----------------------|--|
| Function | Remote operation of front-panel buttons, acknowledge/reset relays, reset max/min values. See <i>Function Keys & Digital I/O Available Settings</i> on page 33 for a complete list of capabilities. |
| Contacts | 3.3 VDC on contact. Connect normally open contacts across F4 to COM |
| Logic Levels | Logic High: 3 to 5 VDC Logic Low: 0 to 1.25 VDC |
| Additional I/O | Up to 2 external modules, model PDA1044 with 4 digital inputs and 4 digital outputs each can be added. |

Modbus® RTU Serial Communications

| | |
|-----------------------------|--|
| Slave Id | 1 – 247 (Meter address) |
| Baud Rate | 300 – 19,200 bps |
| Transmit Time Delay | Programmable between 0 and 199 ms |
| Data | 8 bit (1 start bit, 1 or 2 stop bits) |
| Parity | Even, Odd, or None with 1 or 2 stop bits |
| Byte-To-Byte Timeout | 0.01 to 2.54 sec |
| Turn Around Delay | Less than 2 ms (fixed) |

Note: Refer to the ProVu Modbus Register Tables located at www.predig.com for details.

MeterView Pro

| | |
|----------------------------|--|
| Availability | Download directly from meter or from www.predig.com/download_software |
| System Requirements | Microsoft® Windows® XP/Vista/7/8/10 |
| Communications | USB 2.0 (for programming only) (Standard USB A to Micro USB B) RS-232 adapter, RS-485 adapter and RS-485 to USB converter (programming, monitoring, and data logging) |
| Configuration | Configure meters one at a time |
| Power | USB port provides power to the meter. DO NOT apply AC or DC power to the meter while the USB port is in use. |

Compliance Information

Safety

| | |
|------------------------------|---|
| UL & c-UL Listed | USA & Canada UL 508 Industrial Control Equipment |
| UL File Number | E160849 |
| Front Panel | UL Type 4X, NEMA 4X, IP65; panel gasket provided |
| Low Voltage Directive | EN 61010-1:2010 Safety requirements for measurement, control, and laboratory use |

Electromagnetic Compatibility

| | |
|--------------------------------|--|
| Emissions | EN 55022:2010 Class A ITE emissions requirements |
| Radiated Emissions | Class A |
| AC Mains Conducted Emissions | Class A |
| Immunity | EN 61326-1:2013 Measurement, control, and laboratory equipment EN 61000-6-2:2005 EMC heavy industrial generic immunity standard |
| RFI - Amplitude Modulated | 80 -1000 MHz 10 V/m 80% AM (1 kHz) 1.4 - 2.0 GHz 3 V/m 80% AM (1 kHz) 2.0 - 2.7 GHz 1 V/m 80% AM (1 kHz) |
| Electrical Fast Transients | ±2kV AC mains, ±1kV other |
| Electrostatic Discharge | ±4kV contact, ±8kV air |
| RFI - Conducted | 10V, 0.15-80 MHz, 1kHz 80% AM |
| AC Surge | ±2kV Common, ±1kV Differential |
| Surge | 1KV (CM) |
| Power-Frequency Magnetic Field | 30 A/m 70%V for 0.5 period |
| Voltage Dips | 40%V for 5 & 50 periods 70%V for 25 periods |
| Voltage Interruptions | <5%V for 250 periods |

Note:

Testing was conducted on meters installed through the covers of grounded metal enclosures with cable shields grounded at the point of entry representing installations designed to optimize EMC performance.

Safety Information

⚠ CAUTION

- Read complete instructions prior to installation and operation of the meter.

⚠ WARNINGS

- Risk of electric shock or personal injury.
- Hazardous voltages exist within enclosure. Installation and service should be performed only by trained service personnel.

Installation



There is no need to remove the meter from its case to complete the installation, wiring, and setup.

Unpacking

Remove the meter from box. Inspect the packaging and contents for damage. Report damages, if any, to the carrier. If any part is missing or the meter malfunctions, please contact your supplier or the factory for assistance.

Panel Mounting Instructions

- Prepare a standard 1/8 DIN panel cutout – 3.622" x 1.772" (92 mm x 45 mm). Refer to *Figure 1: 1/8 DIN Panel Cutout and Mounting* below for more details.
- Clearance: allow at least 6.0" (152 mm) behind the panel for wiring.
- Panel thickness: 0.04" - 0.25" (1.0 mm - 6.4 mm). Recommended minimum panel thickness to maintain Type 4X rating: 0.06" (1.5 mm) steel panel, 0.16" (4.1 mm) plastic panel.
- Remove the two mounting brackets provided with the meter (back-off the two screws so that there is ¼" (6.4 mm) or less through the bracket. Slide the bracket toward the front of the case and remove).
- Insert meter into the panel cutout.
- Install mounting brackets and tighten the screws against the panel. To achieve a proper seal, tighten the mounting bracket screws evenly until meter is snug to the panel along its short side. **DO NOT OVER TIGHTEN**, as the rear of the panel may be damaged.

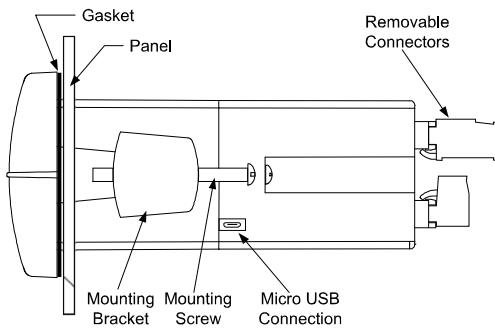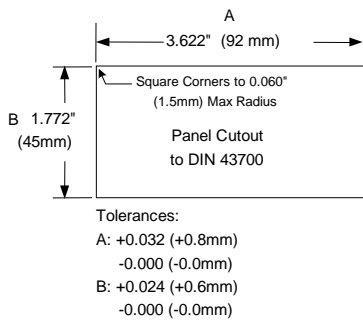

DO NOT apply AC or DC power to the meter when using the Micro USB connection.

Figure 1: 1/8 DIN Panel Cutout and Mounting

Mounting Dimensions

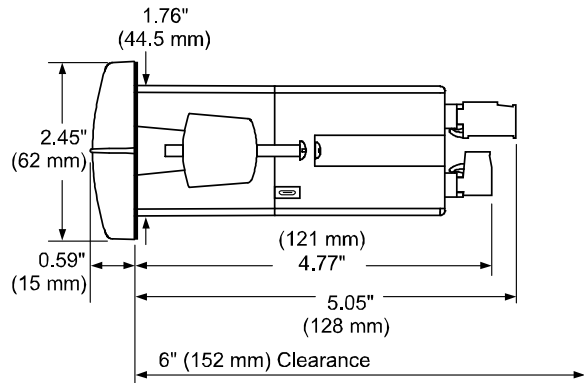


Figure 2. Meter Dimensions - Side View

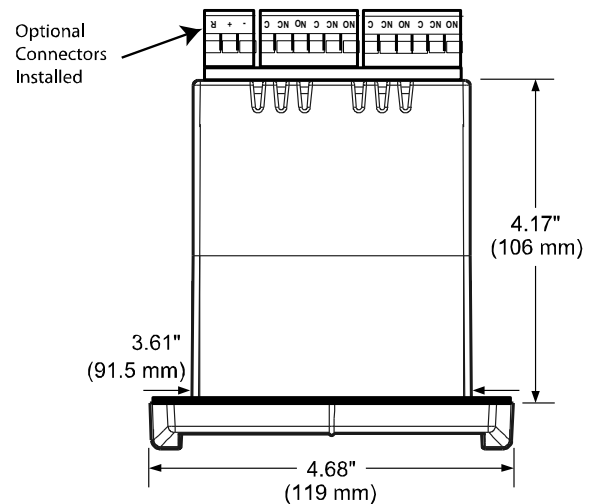


Figure 3. Meter Dimensions - Top View

Download free 3-D CAD files of these instruments to simplify your drawings!

predig.com/documentation-cad

Installation Overview

We recommend the following sequence for getting the meter into service:

1. **DO NOT** apply AC or DC power to the meter.
2. Connect the meter to the PC with the USB cable provided. **DO NOT** use a different USB cable.
3. If MeterView Pro (MVPro) is already installed in your computer, then the program will launch automatically in most systems. If the program does not start automatically, double-click on the MVPro icon.
4. If MVPro is not installed, follow the instructions provided below.
5. Use MVPro to configure the meter for your application.
6. Disconnect the USB cable from the meter.
7. Apply power and signal and check operation of the meter.
8. Install the meter and put into service.
9. Make any programming adjustments using the front panel buttons.

MeterView Pro Software

The easiest and quickest way to program your PROVu meter is to use the FREE MeterView Pro programming software. This software is loaded into the meter and connects and installs directly to your PC with the USB cable provided. **DO NOT** use a different USB cable. We recommend that the first thing you do after taking the meter out of the box is connect the PROVu to your PC with the provided USB cable. **DO NOT** apply AC or DC power to the meter while your PC is connected to the meter as it will disrupt the USB connection. It is not necessary to apply an input signal.

MeterView Pro programming software is intuitive, and most customers can get their meter programmed as they like without even looking in the manual.

Watch Meterview Pro Software Video at www.predig.com/meterviewpro

 
MeterView Pro Installation

1. Connect one end of the provided USB cable to the meter and the other end to the computer. The computer will automatically install the driver software it needs to talk to the meter. Follow the on-screen instructions and allow sufficient time for the process to complete. This can take a few minutes. If the process is interrupted, then it could leave the system in an unstable condition.


⚠️ WARNINGS

- Only one meter may be connected at a time. Attaching multiple meters will cause a conflict with the meter software.
- **DO NOT** apply AC or DC power to the meter when using the Micro USB connection.


2. Once the driver is installed, an AutoPlay dialog should appear for the drive "MAINSTAL." Click "Open folder to view files."



 
If the computer does not display an AutoPlay dialog for the drive "MAINSTAL," you should open My Computer and double-click on the drive labeled "MAINSTAL."



3. Double-click on the file named "MAStart." The program will open a few windows and install two programs on your computer. Simply follow the on-screen instructions until you see one of the dialogs below. If you receive a "User Account Control" warning, click "Yes."

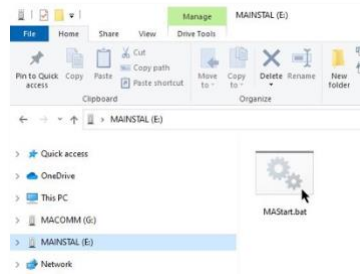

4. If there is an update available, click the "Update" button to install the new version. Otherwise, click "Configure" to begin programming your meter.

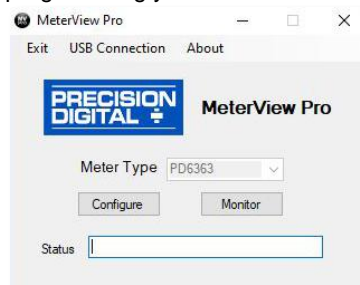

Note: If you decide to update your MeterView Pro software, once the installation has completed, you will be asked if you want to update the setup files located on the meter itself. This way, you will always have the most current version on the meter for future installs.

⚠️ WARNING

- **DO NOT** unplug the meter while the new installation files are being written to it. The meter will display **⚠️ E** during the process and you will receive an on-screen notification once the process is complete.

Connections

All connections are made to removable screw terminal connectors located at the rear of the meter.

CAUTION

- Use copper wire with 60°C or 60/75°C insulation for all line voltage connections. Observe all safety regulations. Electrical wiring should be performed in accordance with all applicable national, state, and local codes to prevent damage to the meter and ensure personnel safety.

Connectors Labeling

The connectors' label, affixed to the meter, shows the location of all connectors available with requested configuration.

Note: ## in the following figures refers to power and display options. (Example: PD7000-6H5)

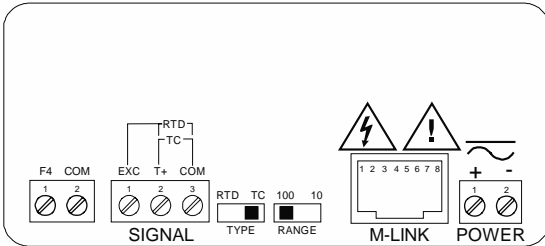


Figure 4. PD7000-##0 Connectors Label

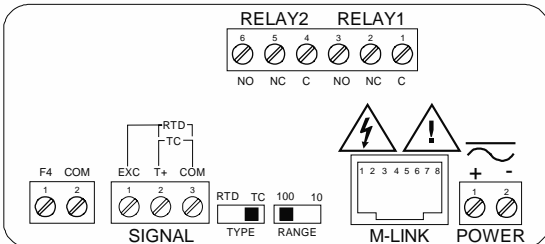


Figure 5. PD7000-##2 Connectors Label

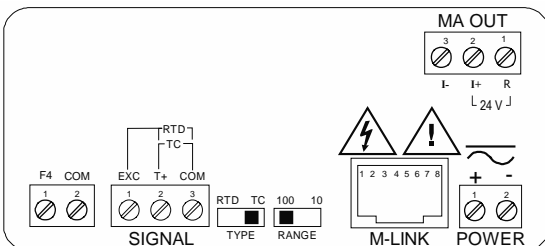


Figure 6. PD7000-##3 Connectors Label

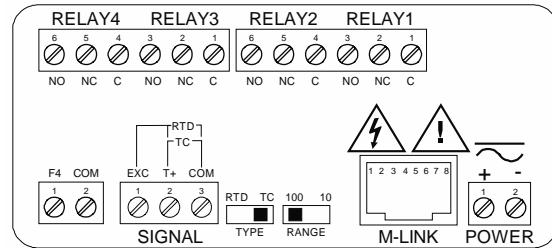


Figure 7. PD7000-##4 Connectors Label

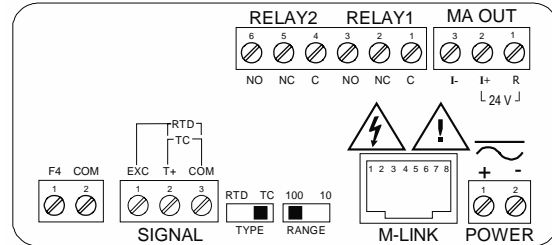


Figure 8. PD7000-##5 Connectors Label

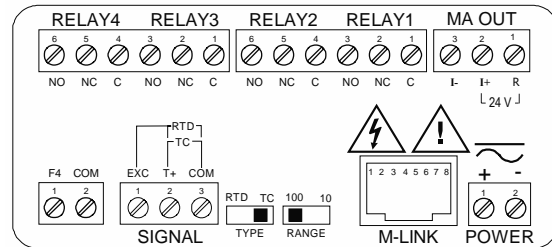



Figure 9. PD7000-##7 Connectors Label

WARNING

- DO NOT** connect any equipment other than Precision Digital's expansion modules, cables, or meters to the RJ45 M LINK connector. Otherwise damage will occur to the equipment and the meter.

Power Connections

Power connections are made to a two-terminal connector labeled POWER. The meter will operate regardless of DC polarity connection. The + and - symbols are only a suggested wiring convention.

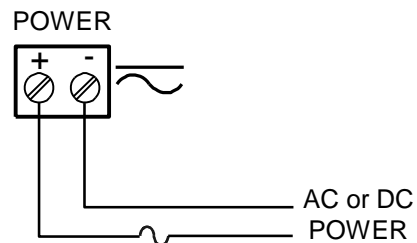

Required External Fuse:
5 A max, 250 V Slow Blow

Figure 10. Power Connections

Signal Connections

Signal connections are made to a three-terminal connector labeled SIGNAL.

Thermocouple and RTD Connections

The following figures show examples for thermocouple and RTD connections.

The TYPE selector switch must be set to the proper position for the meter to accept the selected RTD or TC input.

The RANGE selector switch is used to select 100-ohm platinum or 10-ohm copper RTD. The 1000-ohm platinum RTD input uses the same setting as the 100-ohm RTD.

The input type is selected using the *Setup* menu.

The selected thermocouple input must correspond to the thermocouple sensor and wire type used.

The meter accepts two, three, or four-wire RTDs. The three-wire RTD connection has built-in lead wire compensation.

Lead wire compensation for two-wire RTDs can be applied using the *Adjust* menu. See the *Advanced Features Menu* on page 30.

The four-wire RTD connection is similar to the three-wire. One of the leads of a four-wire RTD is not connected, and may be clipped off.

The three-wire connection provides sufficient lead wire compensation to obtain accurate readings even with long leads.

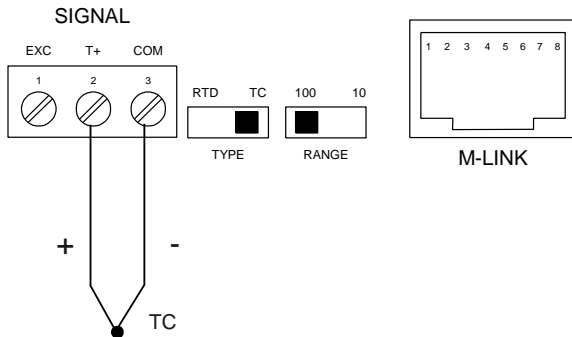


Figure 11. Thermocouple Input Connections

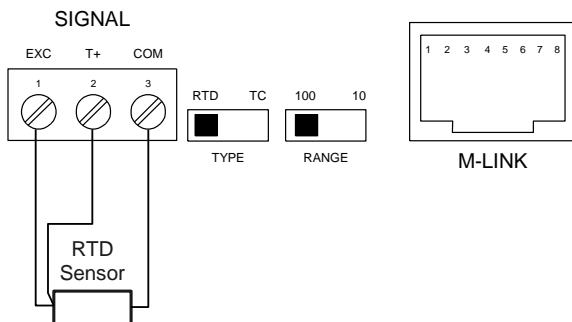


Figure 12. Three-Wire RTD Input Connections

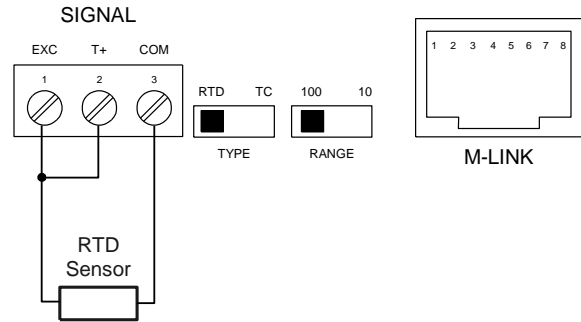


Figure 13. Two-Wire RTD Input Connections

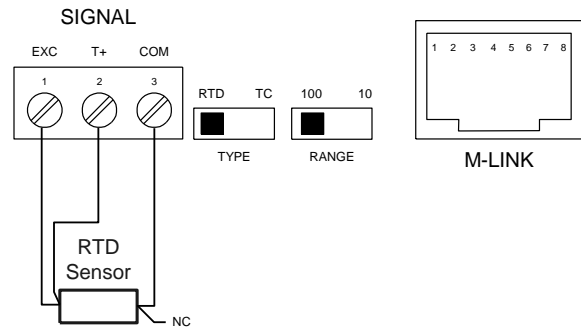


Figure 14. Four-Wire RTD Input Connections

Connections for Averaging RTD Sensors

To obtain the average temperature from 2 to 10 RTD sensors, connect all the sensors in parallel and select the number of sensors in the *RTD Total* (*r t d t o t a l*) menu. See the *Advanced Features Menu* on page 30.

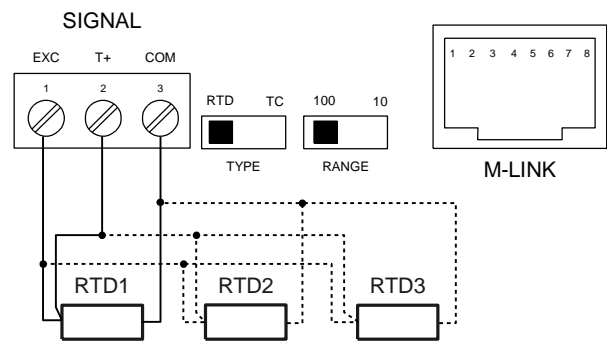


Figure 15. Average Temperature RTD Input Connections

Modbus RTU Serial Communications

Serial communications connection is made to an RJ45 connector labeled M-LINK. For interfacing to the ProVu, use the PDA1232 for RS-232 or the PDA1485 for RS-485. The same port is used for interfacing with all expansion modules (*i.e.* external relays, digital I/O).

Relay Connections

Relay connections are made to two six-terminal connectors labeled RELAY1 – RELAY4. Each relay's C terminal is common only to the normally open (NO) and normally closed (NC) contacts of the corresponding relay. The relays' C terminals should not be confused with the COM (common) terminal of the INPUT SIGNAL connector.

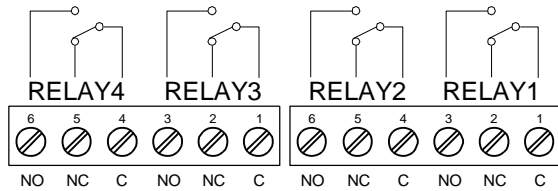


Figure 16. Relay Connections

Switching Inductive Loads

The use of snubbers to suppress electrical noise is strongly recommended when switching inductive loads to prevent disrupting the microprocessor's operation. The snubbers also prolong the life of the relay contacts. Suppression can be obtained with resistor-capacitor (RC) networks assembled by the user or purchased as complete assemblies. Refer to the following circuits for RC network assembly and installation:

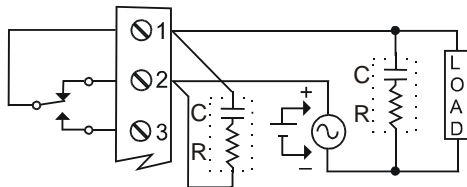



Figure 17. AC and DC Loads Protection

Choose R and C as follows:

- R: 0.5 to 1 Ω for each volt across the contacts
- C: 0.5 to 1 μF for each amp through closed contacts

Notes:

1. Use capacitors rated for 250 VAC.
2. RC networks may affect load release time of solenoid loads. Check to confirm proper operation.
3. Install the RC network at the meter's relay screw terminals. An RC network may also be installed across the load. Experiment for best results.

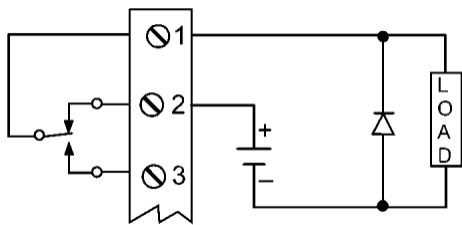

Use a diode with a reverse breakdown voltage two to three times the circuit voltage and forward current at least as large as the load current.

Figure 18. Low Voltage DC Loads Protection

RC Networks (Snubbers) Available from Precision Digital

RC networks are available from Precision Digital and should be applied to each relay contact switching an inductive load. Part number: [PDX6901](#).

Note: Relays are de-rated to 1/14th HP (50 watts) with an inductive load.

F4 Digital Input Connections

A digital input, F4, is standard on the meter. This digital input should be connected with a normally open closure across F4 and COM, or with an active low signal applied to F4. It can be used for remote operation of front-panel buttons, to acknowledge/reset relays, or to reset max/min values. See *Function Keys & Digital I/O Available Settings* on page 33 for a complete list of capabilities.

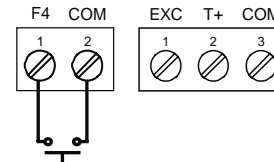


Figure 19. F4 Digital Input Connections 4-20 mA Output Connections

Connections for the 4-20 mA output are made to the connector terminals labeled mA OUT. The 4-20 mA output may be powered internally or from an external power supply.

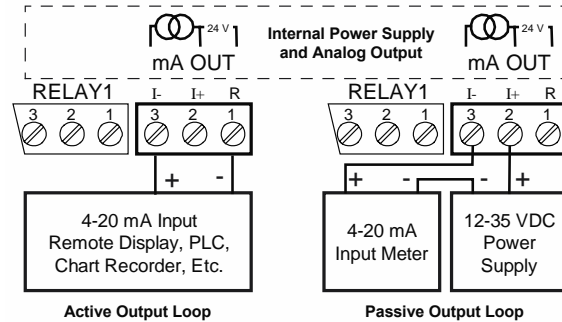


Figure 20. 4-20 mA Output Connections

Analog Output Power Supply

The internal 24 VDC power supply powering the analog output may be used to power other devices, if the analog output is not used. The I+ terminal is the +24 V and the R terminal is the return.

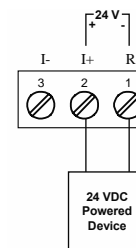


Figure 21. Analog Output Supply Powering Other Devices

External Relays & Digital I/O Connections

The relay and the digital I/O expansion modules PDA1004 & PDA1044 are connected to the meter using a CAT5 cable provided with each module. The two RJ45 connectors on the expansion modules are identical and interchangeable; they are used to connect additional modules to the system.

Note: The jumper located between the RJ45 connectors of the PDA1044 must be removed on the second digital I/O module in order for the system to recognize it as module #2.

⚠ WARNING

- **DO NOT** connect or disconnect the expansion modules with the power on! More detailed instructions are provided with each optional expansion module.

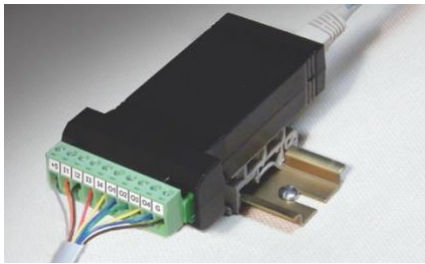


Figure 22. Expansion Module & DIN Rail Mounting Kit

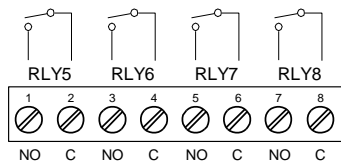


Figure 23. External Relays Module Connections

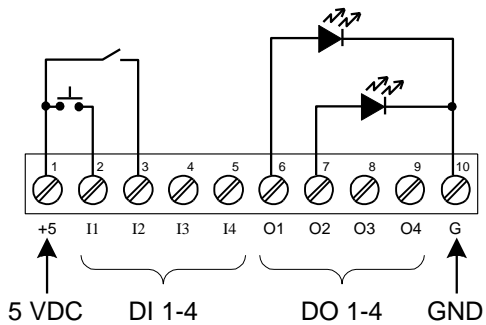


Figure 24. Digital I/O Module Connections

Interlock Relay Feature

As the name implies, the interlock relay feature reassigns one, or more, alarm/control relays for use as interlock relay(s). Interlock contact(s) are wired to digital input(s) and activate the interlock relay. This feature is enabled by configuring the relay, and the corresponding digital input(s), see *Setting Up the Interlock Relay (Force On) Feature* on page 27.

In the example below, an Interlock Contact switch is connected to a digital input, which will be used to force on (energize) the Interlock Relay. The Interlock Relay and the Control Relay are connected in series with the load.

- When the Interlock Contact is closed (safe), the Interlock Relay energizes, allowing power to flow to the Control Relay; the corresponding front panel LED is on.
- When the Interlock Contact is open, the corresponding front panel LED flashes (locked out), the Interlock Relay is de-energized, preventing power from flowing to the Control Relay and the load.

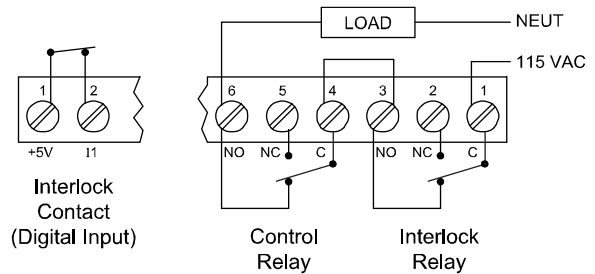


Figure 25. Interlock Connections

Setup and Programming

There is **no need to recalibrate** the meter when first received from the factory. Simply select the input type, °F or °C, and decimal point.

The meter is **factory calibrated** prior to shipment to read temperature in degrees Fahrenheit with calibration equipment that is certified to NIST standards.

Overview

There are two switches, located at the back of the meter, to set the input selection for TC or RTD and for 100-ohm platinum or 10-ohm copper. The 1000-ohm RTD input uses the same setting as the 100-ohm. Setup and programming is done using MeterView Pro or through the front panel buttons.

After power and input signal connections have been completed and verified, apply power to the meter.

Front Panel Buttons and Status LED Indicators



| Button Symbol | Description | LED | Status |
|---|----------------|---|--|
| | Menu | 1-8 | Alarm 1-8 indicator |
| | Right arrow/F1 | 1-8 M | Flashing: Relay in manual control mode |
| | Up arrow/F2 | M | Manual control relays &/or analog output |
| | Enter/F3 | 1-8 | Flashing: Relay interlock switch open |
| <i>Note:</i> F4 is a digital input. Alarms 5-8 are enabled when relay expansion module is installed. | | <i>Note:</i> LEDs for relays in manual mode flash with the "M" LED every 10 seconds. "M" flashing by itself indicates Aout – manual control is used. | |

- Press the Menu button to enter or exit the Programming Mode at any time.
- Press the Right arrow button to move to the next digit during digit or decimal point programming.
- Press or hold the Up arrow button to scroll through the menus, move the decimal point or to increment the value of a digit.
- Press the Enter button to access a menu or to accept a setting.
- Press and hold the Menu button for three seconds to access the advanced features of the meter.

Display Functions & Messages

The meter displays various functions and messages during setup, programming, and operation. The following table shows the main menu functions and messages in the order they appear in the menu.

| Display Functions & Messages | | |
|------------------------------|-------------------|---|
| Display | Parameter | Action/Setting Description |
| SEtUP | Setup | Enter Setup menu |
| InPut | Input | Enter Input selection menu |
| tC | TC | Set meter for thermocouple input J, K, T, E, R, S, B, N, C |
| rtd | RTD | Set meter for RTD input 100Pt, 1000Pt, 10Cu, 120Ni |
| R385 | A385 | Set meter for 0.00385 curve |
| R392 | A392 | Set meter for 0.00392 curve |
| F or C | F or C | Press Enter to select degrees F or C |
| units | Units | Select the display units/tags |
| dec Pt | Decimal point | Set decimal point dddd, dddd.d, dddd°F, dddd.dF |
| dSPLY | Display | Enter the Display menu |
| Line 1 | Line 1 | Press Enter to assign the upper display parameter (default: PV - temperature) |
| Line 2 | Line 2 | Press Enter to assign the lower display parameter (default: engineering units) |
| display intensity | Display intensity | Set display intensity level from 1 to 8 |
| RELAY | Relay | Enter the Relay menu |
| Relay 1 | Relay 1 | Relay 1 setup |
| Action 1 | Action 1 | Set relay 1 action |
| Auto | Automatic | Set relay for automatic reset |
| Auto-manual | Auto-manual | Set relay for automatic & manual reset any time |
| Latching | Latching | Set relay for latching operation |
| Latching-cleared | Latching-cleared | Set relay for latching operation with manual reset only after alarm condition has cleared |
| Alternate | Alternate | Set relay for alternation control |
| Sampling | Sampling | Set relay for sampling operation |


| Display Functions & Messages | | |
|------------------------------|---------------|--|
| Display | Parameter | Action/Setting Description |
| OFF | Off | Disable relay and front panel status LED (Select Off to enable Interlock feature) |
| Set 1 | Set 1 | Program set point 1 |
| Reset 1 | Reset 1 | Program reset point 1 |
| Relay 2 | Relay 2 | Relays 2-8 setup Note: Relays 5-8 are shown only if expansion relay module is installed |
| Fail-safe | Fail-safe | Enter Fail-safe menu |
| Fail-safe 1 | Fail-safe 1 | Set relay 1 fail-safe operation |
| On | On | Enable fail-safe operation |
| Off | Off | Disable fail-safe operation |
| Fail-safe 2 | Fail-safe 2 | Set relays 2-8 fail-safe operation |
| DELAY | Delay | Enter relay Time Delay menu |
| Delay 1 | Delay 1 | Enter relay 1 time delay setup |
| On 1 | On 1 | Set relay 1 On time delay |
| Off 1 | Off 1 | Set relay 1 Off time delay |
| Delay 2 | Delay 2 | Enter relays 2-8 time delay setup |
| Break | Break | Set relay condition if input break detected |
| Ignore | Ignore | Ignore input break condition (Processed as an upscale condition) |
| On | On | Relay goes to alarm condition when input break is detected |
| Off | Off | Relay goes to non-alarm condition when input break is detected |
| Route | Analog output | Enter the Analog output scaling menu |
| Display 1 | Display 1 | Program display 1 value |
| Output 1 | Output 1 | Program output 1 value (e.g. 4.000 mA) |
| Display 2 | Display 2 | Program display 2 value |
| Output 2 | Output 2 | Program output 2 value (e.g. 20.000 mA) |
| RESET | Reset | Press Enter to access the Reset menu |
| Reset High | Reset high | Press Enter to reset max display |
| Reset Low | Reset low | Press Enter to reset min display |

| Display Functions & Messages | | |
|------------------------------|------------------|---|
| Display | Parameter | Action/Setting Description |
| rSt HL | Reset hi/low | Press Enter to reset max & min displays |
| ContrL | Control | Enter Control menu |
| Auto | Automatic | Press Enter to set meter for auto operation |
| MAN | Manual | Press Enter to manually control relays or analog output operation |
| PRSS | Password | Enter the Password menu |
| PRSS 1 | Password 1 | Set or enter Password 1 |
| PRSS 2 | Password 2 | Set or enter Password 2 |
| PRSS 3 | Password 3 | Set or enter Password 3 |
| unLoc | Unlocked | Program password to lock meter |
| Locd | Locked | Enter password to unlock meter |
| 99999 -9999 | Flashing display | Overrange condition Underrange condition |
| OPEN | Open | Open sensor indication |

Main Menu


The main menu consists of the most commonly used functions: *Setup*, *Reset*, *Control*, and *Password*.

- Press Menu button to enter Programming Mode then press the Up arrow button to scroll main menu.
- Press Menu, at any time, to exit and return to Run Mode. Changes made to settings prior to pressing Enter are not saved.
- Changes to the settings are saved to memory only after pressing Enter/F3.
- The display moves to the next menu every time a setting is accepted by pressing Enter/F3.

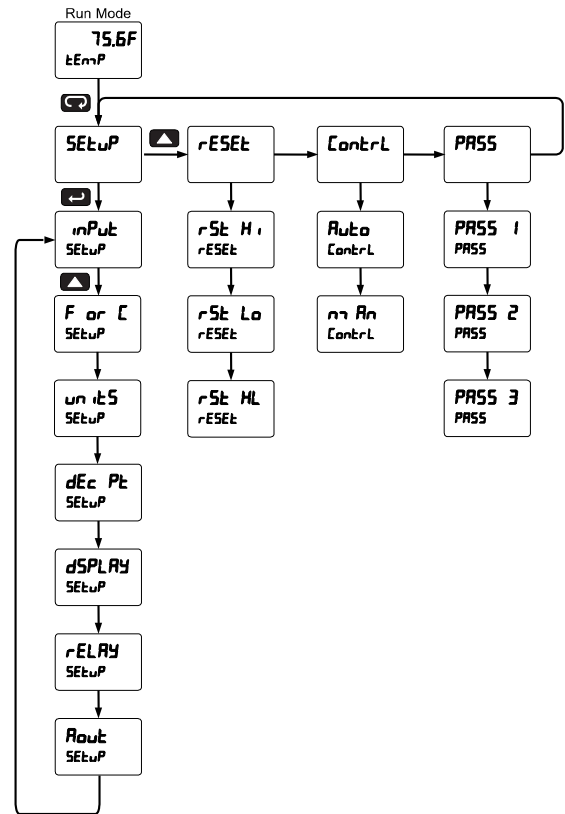

Setting Numeric Values

 The numeric values are set using the Right and Up arrow buttons. Press Right arrow to select next digit and Up arrow to increment digit value. The digit being changed is displayed brighter than the rest. Press and hold up arrow to auto-increment the display value. Press the Enter button, at any time, to accept a setting or Menu button to exit without saving changes.




Setting Up the Meter (SEtUP)

The Setup menu is used to select:

1. Input type the meter will accept
2. Degrees F or C
3. Select the display units/tags
4. Decimal point position and F or C indication
5. Display parameter and intensity
6. Relay operation
7. 4-20 mA analog output scaling

Press the Enter button to access any menu or press Up arrow button to scroll through choices. Press the Menu button to exit at any time.

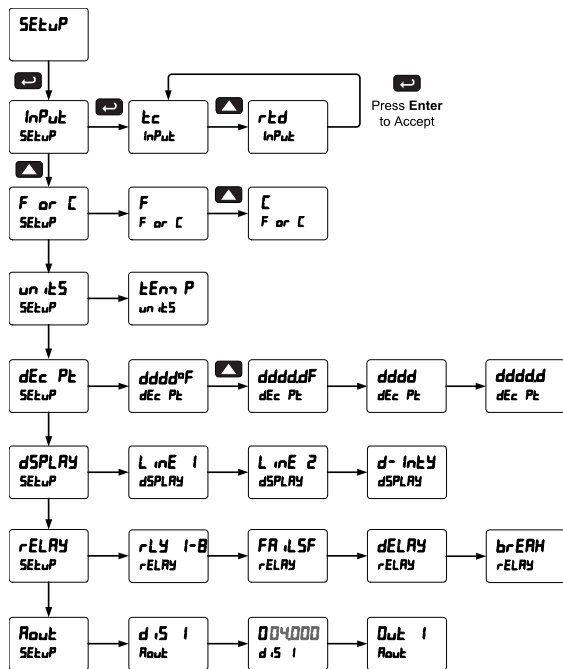

Setting the Input Signal (InPut)

Enter the Input menu to set up the meter to accept thermocouple (tc) or RTD (rtd) inputs. The Type selector switch, located at the rear of the meter, must be set accordingly. The thermocouple input is capable of accepting various types of thermocouples. The RTD input is capable of accepting various types of RTD sensors. After selecting 100 Pt or 1000Pt, it is necessary to select either A385 (0.00385) or A392 (0.00392) coefficient.

Selecting the Temperature Scale (F or C)

The meter can display the temperature in degrees Fahrenheit or Celsius.

Setting the Decimal Point (dEc Pt)

The temperature may be displayed with one decimal or with no decimal point. The temperature scale can also be displayed with the reading. The degree symbol is available only with no decimal point selected. Pressing the Up arrow scrolls the decimal point and temperature format selections.


Setting the Display Parameter & Intensity (dSPLeRY)

Display line 1 (L inE 1) can be programmed to display:

1. Process value
2. Relay set points
3. Max & min values
4. Modbus input
5. Display reading and units

Display line 2 (L inE 2) can be programmed to display:

1. Process value
2. Relay set points
3. Max & min values
4. Engineering units or custom legends
5. Modbus input
6. Off (no display)
7. Display reading and units

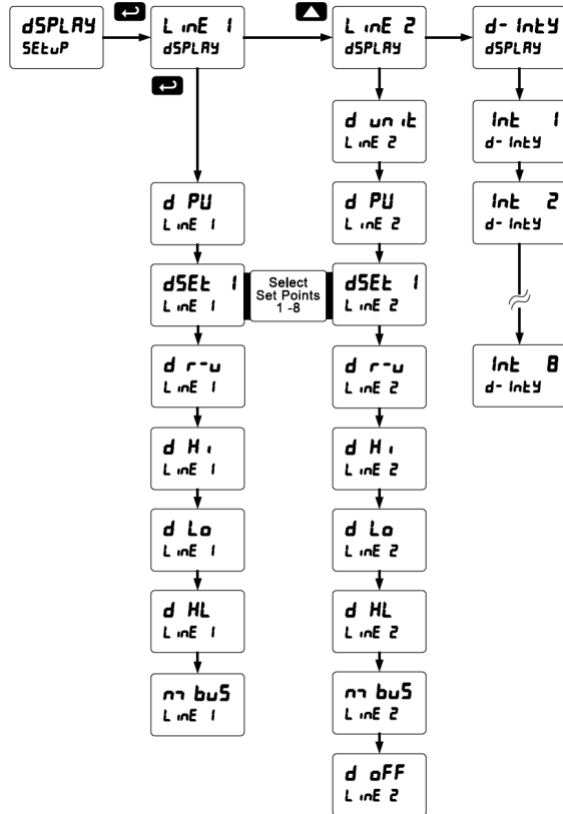

Press the Up arrow to change selection, press Enter to accept setting, and press Menu to exit programming

After setting up the input and display, press the Menu button to exit programming and skip the rest of the setup menu. Press the Menu button again and the Up arrow to reach the Setup menu again and complete the setup of the meter.

Display Intensity (d- IntY)

The meter has eight display intensity levels to give the best performance under various lighting conditions. Select intensity 8 for outdoor applications. The default intensity is 6.

Setting the Display Units or Custom Tags (un itS)

Enter the display unit or custom tag that will be displayed if units is selected in the un itS menu, or d un it is selected as the Lower display parameter. See the *Setting the Display Parameter & Intensity (dSPLeRY)* flow chart on page 21 to access the display menu to show the unit or tag on the Lower display. The engineering units or custom legends can be set using the following 7-segment character set:

| Display | Character |
|---------|-----------|
| 0 | 0 |
| 1 | 1 |
| 2 | 2 |
| 3 | 3 |
| 4 | 4 |
| 5 | 5 |
| 6 | 6 |
| 7 | 7 |
| 8 | 8 |
| 9 | 9 |
| A | A |
| b | b |
| C | C |
| c | c |
| d | d |
| E | E |
| F | F |
| G | G |
| g | g |
| H | H |
| h | h |
| i | i |
| l | l |
| J | J |

| Display | Character |
|-----------|-----------|
| K | K |
| L | L |
| m | m |
| n | n |
| O | O |
| o | o |
| P | P |
| q | q |
| r | r |
| S | S |
| t | t |
| u | u |
| V | V |
| w | w |
| X | X |
| Y | Y |
| Z | Z |
| - | - |
| / | / |
|] |] |
| [| [|
| = | = |
| Degree(<) | Degree(<) |
| Space | Space |

Notes:

Degree symbol represented by (<) if programming with MeterView Pro.

The letters "m" and "w" use two 7-segment LEDs each; when selected the characters to the right are shifted one position.

Press and hold up arrow to auto-scroll the characters in the display.


Setting the Relay Operation (rELAY)

This menu is used to set up the operation of the relays.

CAUTION

- During setup, the relays do not follow the input and they will remain in the state found prior to entering the Relay menu.

1. Relay action
 - a. Automatic reset only (non-latching)
 - b. Automatic + manual reset at any time (non-latching)
 - c. Latching (manual reset only)
 - d. Latching with Clear (manual reset only after alarm condition has cleared)
 - e. Relay alternation control (automatic reset only)
 - f. Sampling (the relay is activated for a user-specified time)
 - g. Off (relay disabled and Interlock feature enabled)
2. Set point
3. Reset point
4. Fail-safe operation
 - a. On (enabled)
 - b. Off (disabled)
5. Time delay
 - a. On delay (0-999.9 seconds)
 - b. Off delay (0-999.9 seconds)
6. Relay action for loss (break) of input (ignore, on, off)

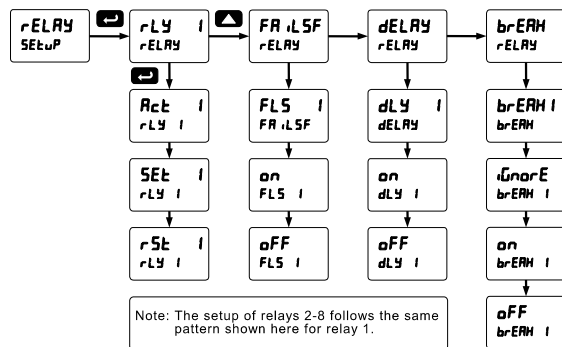


Setting the Relay Action

Operation of the relays is programmed in the *Action* menu. The relays may be set up for any of the following modes of operation:

1. Automatic reset (non-latching)
2. Automatic + manual reset at any time (non-latching)
3. Latching (manual reset only, at any time)
4. Latching with Clear (manual reset only after alarm condition has cleared)
5. Relay alternation control (automatic reset only)
6. Sampling (the relay is activated for a user-specified time)
7. Off (relay disabled and Interlock feature enabled)

The following graphic shows relay 1 action setup; relay 2-8 are set up in a similar fashion.

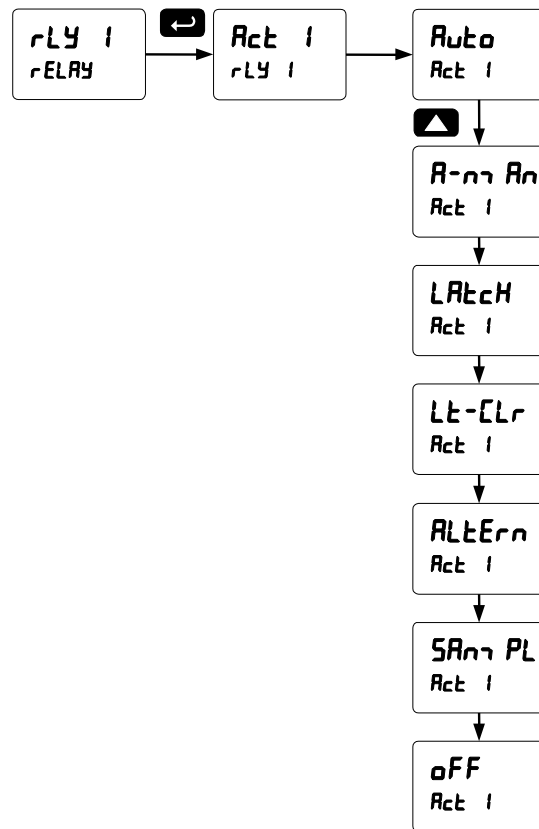


Programming Set and Reset Points

High alarm indication: program set point above reset point.

Low alarm indication: program set point below reset point.

The deadband is determined by the difference between set and reset points. Minimum deadband is one display count. If the set and reset points are programmed with the same value, the relay will reset one count below the set point.

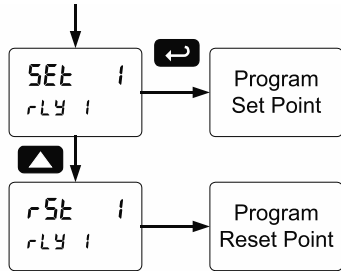

Note: Changes are not saved until the reset point has been accepted.

Setting Fail-Safe Operation

In fail-safe mode of operation, the relay coil is energized when the process variable is within safe limits and the relay coil is de-energized when the alarm condition exists. The fail-safe operation is set independently for each relay. Select **on** to enable or select **oFF** to disable fail-safe operation.

Programming Time Delay

The *On* and *Off* time delays may be programmed for each relay between 0 and 999.9 seconds. The relays will transfer only after the condition has been maintained for the corresponding time delay.

The *On* time delay is associated with the set point.

The *Off* time delay is associated with the reset point.

Relay Action for Loss of Input (Input Break)


Each relay may be programmed to go to one of the following conditions when the meter detects the loss of the input signal:

1. Turn *On* (Go to alarm condition)
2. Turn *Off* (Go to non-alarm condition)
3. Ignore (Processed as an upscale condition)

Relay and Alarm Operation Diagrams

The following graphs illustrate the operation of the relays, status LEDs, and ACK button.


High Alarm Operation (Set > Reset)

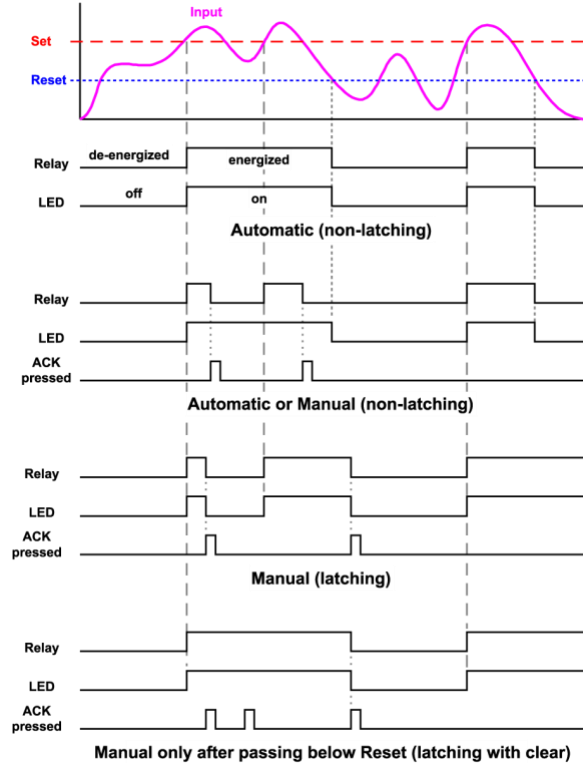

Manual only after passing below Reset (latching with clear)

For Manual reset mode, ACK can be pressed anytime to turn "off" relay. To detect a new alarm condition, the signal must go below the set point, and then go above it.


Low Alarm Operation (Set < Reset)

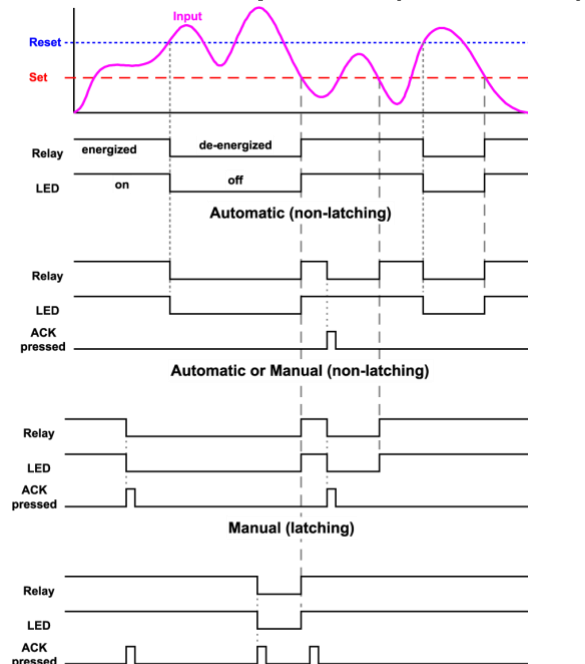

Manual only after passing above Reset (latching with clear)


For Manual reset mode, ACK can be pressed anytime to turn "off" relay. For relay to turn back "on", signal must go above set point and then go below it.

High Alarm with Fail-Safe Operation (Set > Reset)

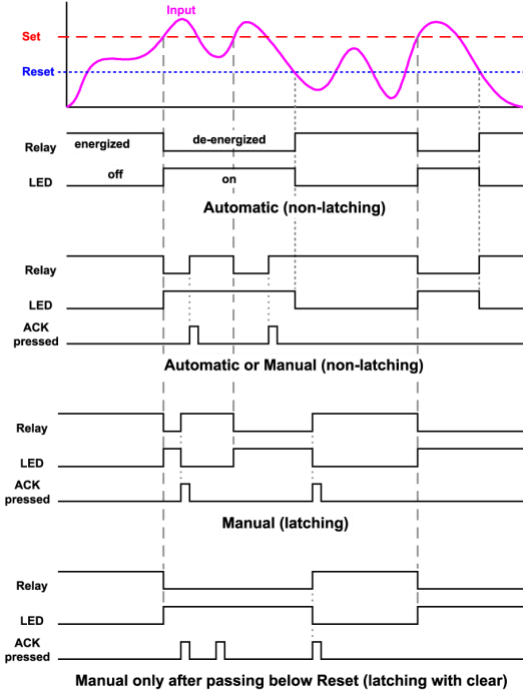


Note: Relay coil is energized in non-alarm condition. In case of power failure, relay will go to alarm state.

Low Alarm with Fail-Safe Operation (Set < Reset)

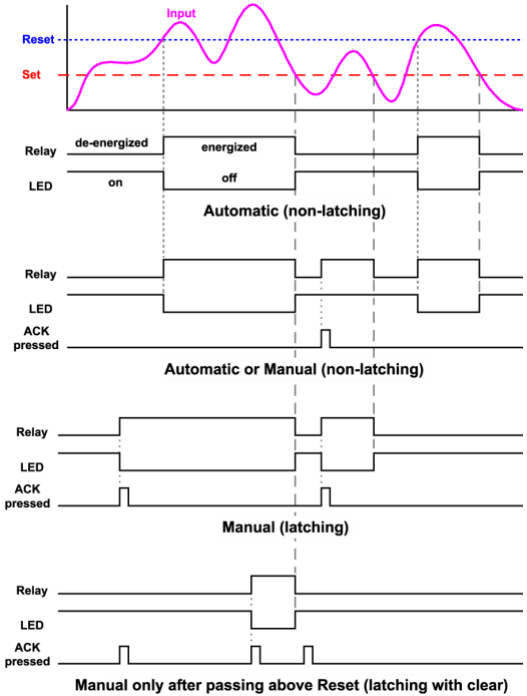

Note: Relay coil is energized in non-alarm condition. In case of power failure, relay will go to alarm state.

Relay Sampling Operation

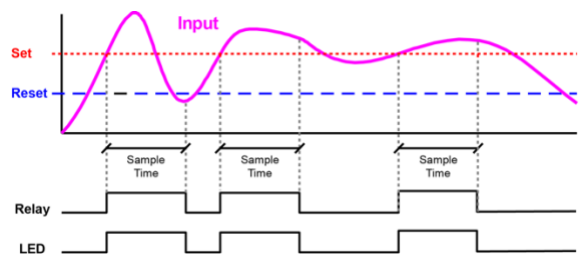


When the signal crosses the set point, the relay trips and the sample time starts. After the sample time has elapsed, the relay resets. The cycle repeats every time the set point is crossed, going up for high alarms and going down for low alarms.

The sample time can be programmed between 0.1 and 5999.9 seconds.

Signal Loss or Input Break Relay Operation

The following graph shows the input break relay operation for a high alarm relay.

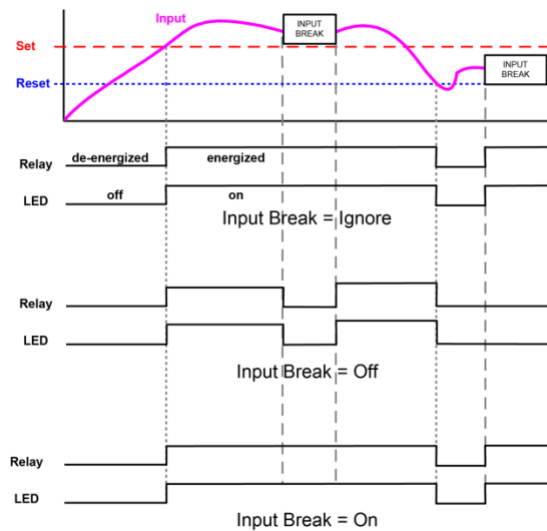


When the meter detects a break in the input, the relay will go to one of the following selected actions:

1. Turn On (Go to alarm condition)
2. Turn Off (Go to non-alarm condition)
3. Ignore (Processed as an upscale condition)

Time Delay Operation

The following graphs show the operation of the time delay function.

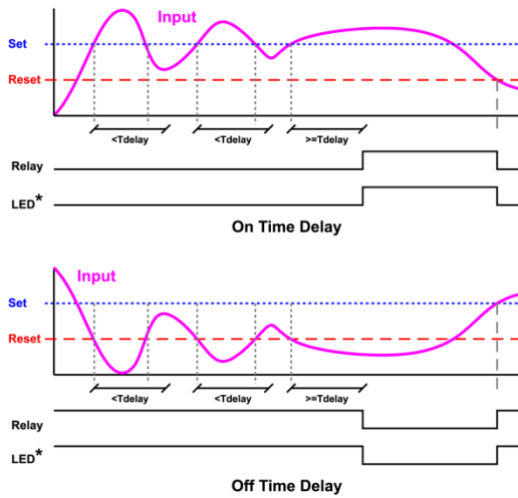

When the signal crosses the set point, the *On* time delay timer starts and the relay trips when the time delay has elapsed. If the signal drops below the set point (high alarm) before the time delay has elapsed, the *On* time delay timer resets and the relay does not change state. The same principle applies to the *Off* time delay.

Note: If “Automatic or Manual (R-n-Rn)” reset mode is selected, the LED follows the reset point and not the relay state when the relay is acknowledged.

Relay Operation Details

Overview

The relay capabilities of the meter expand its usefulness beyond simple indication to provide users with alarm and control functions. These capabilities include front panel alarm status LEDs as well as either 2 or 4 optional internal relays and/or 4 external relays expansion module. Typical applications include high or low temperature alarms, control applications such as simple on/off temperature control. There are four basic ways the relays can be used:

1. High or Low Alarms with Latching or Non-Latching Relays
2. Simple On/Off Control with 100% Adjustable Deadband
3. Sampling (Based on Time)
4. Relay Alternation Control

Relays Auto Initialization

When power is applied to the meter, the front panel LEDs and alarm relays will reflect the state of the input to the meter. The following table indicates how the alarm LEDs and relays will react on power-up based on the set and reset points:

| Alarm # | HI or LO Alarm | Set Point | Reset Point | Power-Up Reading | Relay & LED |
|---------|----------------|-----------|-------------|------------------|-------------|
| 1 | HI | 1000 | 500 | 499 | Off |
| 2 | LO | 700 | 900 | 499 | On |
| 3 | LO | 250 | 400 | 499 | Off |
| 4 | HI | 450 | 200 | 499 | On |

Fail-Safe Operation

The following table indicates how the relays behave based on the fail-safe selection for each relay:

| Fail-Safe Selection | Non-Alarm State | | Alarm State | | Power Failure |
|---------------------|-----------------|--------|-------------|--------|------------------------------|
| | NO | NC | NO | NC | |
| Off | Open | Closed | Closed | Open | Relays go to non-alarm state |
| On | Closed | Open | Open | Closed | Relays go to alarm state |

Note: NO = Normally Open, NC = Normally Closed. This refers to the condition of the relay contacts when the power to the meter is off.

Front Panel LEDs

The LEDs on the front panel provide status indication for the following:

| LED | Status | LED | Status |
|-----|---------|-----|---------|
| 1 | Alarm 1 | 5 | Alarm 5 |
| 2 | Alarm 2 | 6 | Alarm 6 |
| 3 | Alarm 3 | 7 | Alarm 7 |
| 4 | Alarm 4 | 8 | Alarm 8 |

The meter is supplied with four alarm points that include front panel LEDs to indicate alarm conditions. This standard feature is particularly useful for alarm applications that require visual-only indication. The LEDs are controlled by the set and reset points programmed by the user. When the display reaches a set point for a high or low alarm, the corresponding alarm LED will turn on. When the display returns to the reset point the LED will go off. The front panel LEDs respond differently for latching and non-latching relays.

For non-latching relays, the LED is always off during normal condition and always on during alarm condition, regardless of the state of the relay (e.g. Relay acknowledged after alarm condition).

For latching relays, the alarm LEDs reflect the status of the relays, regardless of the alarm condition. The following tables illustrate how the alarm LEDs function in relation to the relays and the acknowledge button (Default: F3 key assigned to ACK).

Latching and Non-Latching Relay Operation

The relays can be set up for latching (manual reset) or non-latching (automatic reset) operation.

| Relay terminology for following tables | |
|--|-----------------|
| Terminology | Relay Condition |
| On | Alarm (Tripped) |
| Off | Normal (Reset) |
| Ack | Acknowledged |

The On and Off terminology does not refer to the status of the relay's coil, which depends on the fail-safe mode selected.

WARNING

- In latching relay mode, if Fail-Safe is off, latched relays will reset (unlatch) when power is cycled.

Non-Latching Relay (Relay)

In this application, the meter is set up for automatic reset (non-latching relay). Acknowledging the alarm while it is still present has no effect on either the LED or the relay. When the alarm finally goes away, the relay automatically resets and the LED also goes off.

| Automatic reset only | | |
|----------------------|-----|-------|
| Condition | LED | Relay |
| Normal | Off | Off |
| Alarm | On | On |
| Ack (No effect) | On | On |
| Normal | Off | Off |

Non-Latching Relay with Manual Reset (Relay)

In this application, the meter is set up for automatic and manual reset at any time (non-latching relay). The LED and the relay automatically reset when the meter returns to the normal condition.

In addition, the relay can be manually reset while the alarm condition still exists, but the LED will stay on until the meter returns to the normal condition.

| Automatic + manual reset at any time | | |
|--------------------------------------|-----|-------|
| Condition | LED | Relay |
| Normal | Off | Off |
| Alarm | On | On |
| Normal | Off | Off |
| Next Alarm | On | On |
| Ack | On | Off |
| Normal | Off | Off |

Latching Relay (Relay)

In this application, the meter is set up for manual reset at any time. Acknowledging the alarm even if the alarm condition is still present resets the relay and turns off the LED.

| Manual reset any time | | |
|-----------------------|-----|-------|
| Condition | LED | Relay |
| Normal | Off | Off |
| Alarm | On | On |
| Ack | Off | Off |

Latching Relay with Clear (Lr - Lr)


In this application, the meter is set up for manual reset only after the signal passes the reset point (alarm condition has cleared). Acknowledging the alarm while it is still present has no effect on either the LED or the relay. When the alarm is acknowledged after it returns to the normal state, the LED and the relay go off. Notice that the LED remains on, even after the meter returns to the normal condition. This is because, for latching relays, the alarm LED reflects the status of the relay, regardless of the alarm condition.

| Manual reset only after alarm condition has cleared | | |
|---|-----|-------|
| Condition | LED | Relay |
| Normal | Off | Off |
| Alarm | On | On |
| Ack (No effect) | On | On |
| Normal | On | On |
| Ack | Off | Off |


Acknowledging Relays

There are three ways to acknowledge relays programmed for manual reset:


1. Via the programmable front panel function keys F1-F3 (Example: F3 assigned to ACK).

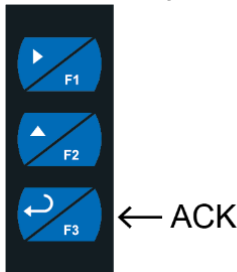

2. Remotely via a normally open pushbutton wired to the F4 terminal at the rear of the instrument.

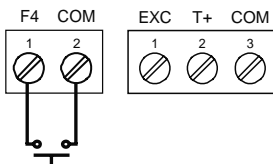

3. One of the digital inputs and the +5 V terminals on the digital I/O expansion module.

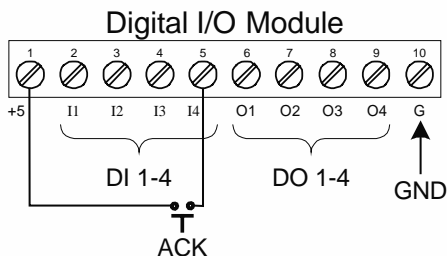


When the ACK button or the assigned digital input is closed, all relays programmed for manual reset are acknowledged.


Setting Up the Interlock Relay (Force On) Feature

Relays 1-4 can be set up as interlock relays. To set up the relays for the interlock feature:


1. Access the Setup - Relay - Action menu and set the action to off.

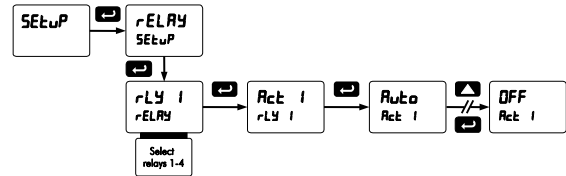

 2. In the Advanced features - User menu program any of the digital inputs to Force On any of the internal relays (1-4).



3. Connect a switch or dry contact between the +5V terminal and the corresponding digital input (DI-1 to DI-4) terminal.

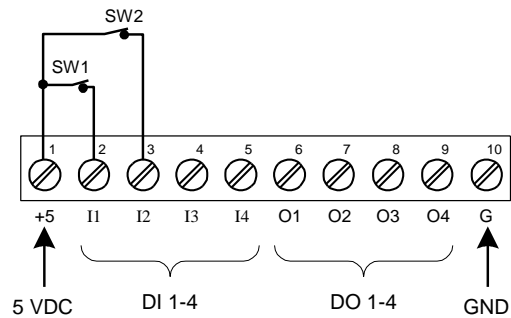

Interlock Relay Operation

Relays 1 & 2 are configured to energize (their front panel LEDs are steady on) when SW1 & SW2 switches (above) are closed. If the contacts to these digital inputs are opened, the corresponding front panel LEDs flash indicating this condition. The processes being controlled by the interlock relay will stop, and will re-start only after the interlock relay is re-activated by the digital inputs (switches).


Note: If multiple digital inputs are assigned to the same relay, then the corresponding logic is (AND) – i.e. both switches must be closed to activate the relay.

Scaling the 4-20 mA Analog Output (Rout)

The 4-20 mA analog output can be scaled to provide a 4-20 mA signal for any display range selected.

No equipment is needed to scale the analog output; simply program the display values to the corresponding mA output signal.

The *Analog Output* menu is used to program the 4-20 mA output based on display values.

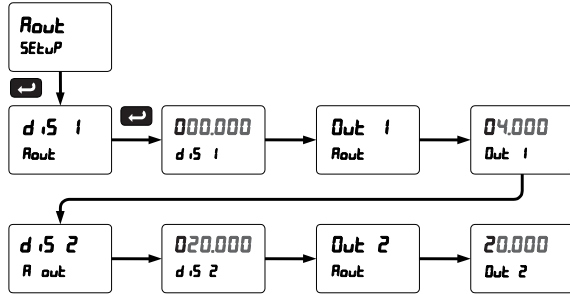

Note: During the analog output scaling, the display value is always indicated with a decimal point regardless of the decimal point selection for the temperature display.


For instructions on how to program numeric values see *Setting Numeric Values*, page 19.

Reset Menu (rESEt)

The *Reset* menu is used to reset the maximum or minimum reading (peak or valley) reached by the process; both may be reset at the same time by selecting “reset high & low” (rSEt HL).

Manual Control Menu (Contrl)

The *Manual Control* menu is used to control the 4-20 mA analog output and the relays manually, ignoring the input. Each relay and analog output can be programmed independently for manual control. Selecting automatic control sets all relays and analog output for automatic operation.

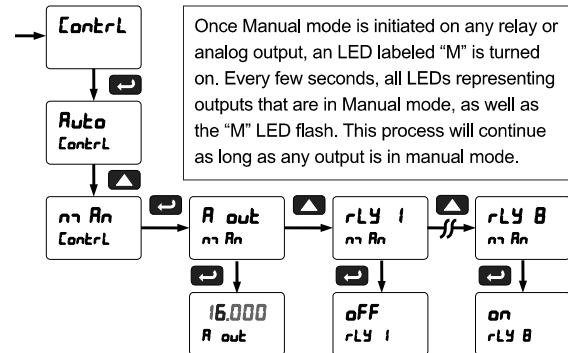

Setting Up the Password (PASS)


The *Password* menu is used for programming three levels of security to prevent unauthorized changes to the programmed parameter settings.

- Pass 1: Allows use of function keys and digital inputs
- Pass 2: Allows use of function keys, digital inputs and editing set/reset points
- Pass 3: Restricts all programming, function keys, and digital inputs.

Protecting or Locking the Meter

Enter the *Password* menu and program a six-digit password.

For instructions on how to program numeric values see *Setting Numeric Values*, page 19.

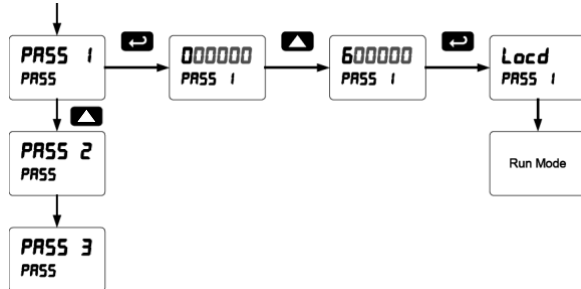


Making Changes to a Password Protected Meter

If the meter is password protected, the meter will display the message *Locd* (*Locked*) when the Menu button is pressed. Press the Enter button while the message is being displayed and enter the correct password to gain access to the menu.

Note: After exiting the programming mode, the meter returns to its password protected condition

Disabling Password Protection

To disable the password protection, access the *Password* menu and enter the correct password twice, as shown below. The meter is now unprotected until a new password is entered.

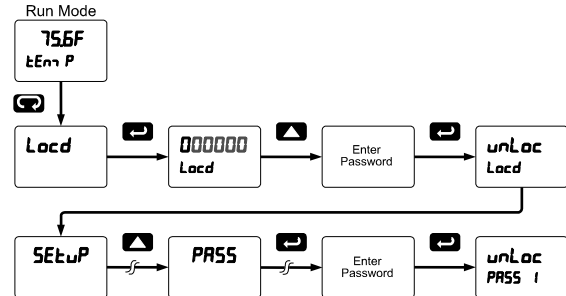

If the correct six-digit password is entered, the meter displays the message *unLoc* (*unlocked*) and the protection is disabled until a new password is programmed.

If the password entered is incorrect, the meter displays the message *Locd* (*Locked*) for about two seconds, and then it returns to Run Mode. To try again, press Enter while the *Locked* message is displayed.


Did you forget the password?

The password may be disabled by entering a master password once. If you are authorized to make changes, enter the master password 508655 to unlock the meter.

Advanced Features Menu

To simplify the setup process, functions not needed for most applications are located in the *Advanced Features* menu.

Press and hold the Menu button for three seconds to access the advanced features of the meter.

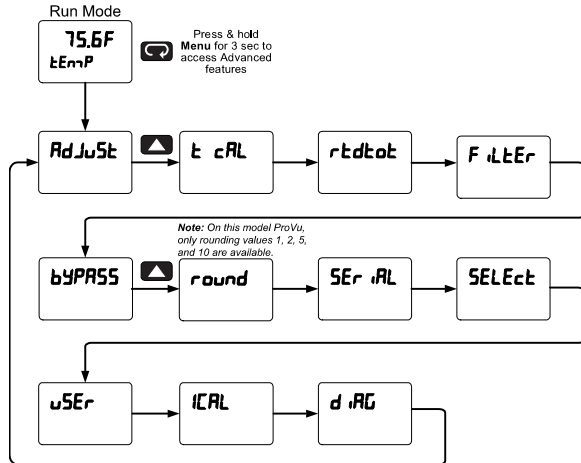

Advanced Features Menu & Display Messages

The following table shows the functions and messages of the *Advanced Features* menu in the order they appear in the menu.

| Display | Parameter | Action/Setting |
|----------------|----------------|--|
| Adjust | Adjust | Set adjust value to offset temperature reading |
| T Cal | T Cal | Enter temperature calibration menu |
| T Low | T Low | Apply the low temperature input (e.g. 32°F) |
| T High | T High | Apply the high temperature input (e.g. 1000°F) |
| RTD Total | RTD Total | Set the number of RTDs connected in parallel to obtain average temperature |
| Filter | Filter | Set noise filter value |
| Bypass | Bypass | Set filter bypass value |
| Round | Round | Set the rounding value for display variables |
| Serial | Serial | Set serial communication parameters |
| Slave ID | Slave ID | Set slave ID or meter address |
| Baud rate | Baud rate | Select baud rate |
| Transmit delay | Transmit delay | Set transmit delay for serial communication |

| Display | Parameter | Action/Setting |
|---------------------------|---------------------------|--|
| Parity | Parity | Select parity Even, Odd, or None with 1 or 2 stop bits |
| Time byte | Time byte | Set byte-to-byte timeout |
| Select | Select | Enter the Select menu |
| Analog output programming | Analog output programming | Program analog output parameters |
| Source | Source | Select source for the 4-20 mA output |
| Overrange | Overrange | Program mA output for display overrange |
| Underrange | Underrange | Program mA output for display underrange |
| Loop Break | Loop Break | Set relay condition if loop break detected |
| Maximum | Maximum | Program maximum mA output allowed |
| Minimum | Minimum | Program minimum mA output allowed |
| Calibrate | Calibrate | Calibrate 4-20 mA output (internal reference source used for scaling the output) |
| 4 mA output | 4 mA output | Enter mA output value read by milliamp meter with at least 0.001 mA resolution |
| 20 mA output | 20 mA output | Enter mA output value read by milliamp meter with at least 0.001 mA resolution |
| User I/O | User I/O | Assign function keys and digital I/O |
| F1 | F1 function key | Assign F1 function key |
| F2 | F2 function key | Assign F2 function key |
| F3 | F3 function key | Assign F3 function key |
| F4 | F4 function | Assign F4 function (digital input) |
| Digital input 1 | Digital input 1 | Assign digital input 1- 8, if expansion modules are connected |
| Digital output 1 | Digital output 1 | Assign digital output 1- 8, if expansion modules are connected |
| Internal temp calibration | Internal temp calibration | Enter internal temperature calibration (used for factory calibration only) |

| Display | Parameter | Action/Setting |
|---------|-------------------------|---|
| ྲྀྱ | Measured temp reference | Enter the measured reference temperature in degrees Celsius (e.g. 25.0) |
| ྲྀྱ | 0 mV | Apply 0.000 mV input Internal Calibration |
| ྲྀྱྱ | 100 mV | Apply 100.000 mV input |
| ྲྀྱ | Diagnostics | Display parameter settings |
| ྲྀྱ | LED test | Test all LEDs (press menu to exit test) |
| ྲྀྱ | Information | Display software number and version |
| ྲྀྱ | Erase | Erase MeterView Pro software stored in meter's memory |

Offset Adjust (ྲྀྱ)

This parameter allows the user to select an offset adjustment to the temperature being displayed. Offset adjustment values can be either positive or negative and can be any number within ±50.0°F (±27.8°C). The offset adjustment value is programmed through the *Adjust* menu.

The offset adjustment feature can be useful to compensate for errors due to thermocouple junctions or excessive lead wire resistance in RTDs.

Note: The offset adjustment value is not reset to zero when the type of temperature sensor is changed (i.e. TC type or RTD curve). Celsius/Fahrenheit conversion must be made manually by the user.

Recalibration of the Meter (ྲྀྱ)

The *Calibration* (ྲྀྱ) menu is used to **recalibrate** the thermocouple and RTD inputs.

- There is **no need to recalibrate** the meter when first received from the factory. Simply select the input type, °F or °C, and decimal point.
- The meter is **factory calibrated** prior to shipment to read temperature in degrees Fahrenheit with calibration equipment that is certified to NIST standards.
- Check calibration of the meter at least every 12 months.

Allow at least 30 minutes warm-up time before performing recalibration procedure to ensure specified accuracy.

Recommended Calibration Points

To recalibrate the meter, it is recommended to use the Fahrenheit scale; this will give a greater degree of accuracy to the calibration. The scale can be changed to the Celsius scale after calibration is completed. The meter will display temperature accurately in any scale. The following table shows the recommended low and high calibration points for all types.

| Type of input | Input 1 (Low) | Input 2 (High) | Check (Middle) |
|-------------------------|----------------|-------------------|------------------|
| Type J | 32°F | 1184°F | 600°F |
| Type K | 32°F | 1895°F | 960°F |
| Type T | 32°F | 698°F | 360°F |
| Type E | 32°F | 1652°F | 800°F |
| Type R | 32°F | 3110°F | 1500°F |
| Type S | 32°F | 3110°F | 1500°F |
| Type B | 32°F | 3110°F | 1500°F |
| Type N | 32°F | 1472°F | 700°F |
| Type C | 500°F | 3650°F | 1800°F |
| 10 Ω Cu RTD | 32°F 9.035Ω | 450°F 18.032Ω | 200°F 12.639Ω |
| 100 Ω Pt RTD (0.00385) | 32°F 100Ω | 1148°F 320.12Ω | 590°F 215.61Ω |
| 100 Ω Pt RTD (0.00392) | 32°F 100Ω | 1148°F 324.49Ω | 590°F 217.89Ω |
| 120 Ω Ni RTD | 32°F 120Ω | 410°F 315.31Ω | 221°F 205.22Ω |
| 1000 Ω Pt RTD (0.00385) | 32°F 1000Ω | 900°F 2750.4Ω | 450°F 1876.5Ω |
| 1000 Ω Pt RTD (0.00392) | 32°F 1000Ω | 900°F 2785.1Ω | 450°F 1893.7Ω |

Recalibration Procedure

1. Connect signal to the meter using the appropriate wire (e.g. type J thermocouple wire to recalibrate type J input). See *Signal Connections* on page 14.
2. Set up the meter to accept the selected input (e.g. type J T/C). See *Setting Up the Meter* (ྲྀྱ) on page 20.
3. Set up the meter to display temperature in degrees Fahrenheit.
4. Apply signal corresponding to input 1 (32°F) and program the display to read 32.0.
5. Apply signal corresponding to input 2 (1184°F for type J) and program the display accordingly.
6. After the meter accepts input 2, the display returns to reading mode. This completes the recalibration procedure for the selected input.

Noise Filter (ྲྀྱ)

The noise filter is available for unusually noisy signals that cause an unstable process variable display. The noise filter averages the input signal over a certain period. The filter level determines the length of time over which the signal is averaged. The filter level can be set between 2 and 199. The higher the filter level, the longer the averaging time and so the longer it takes the display to settle to its final value. Setting the filter level to zero disables the filter function.

Noise Filter Bypass (bYPASS)

The noise filter bypass changes the behavior of the meter so that small variations in the signal are filtered out but large abrupt changes in the input signal are displayed immediately. The bypass value determines the minimum amount of signal change to be displayed immediately. All signal changes smaller than the bypass value are filtered or averaged by the meter. The noise filter bypass may be set between 0.1 and 99.9% of full scale.

Rounding Feature (rOund)

The rounding feature is used to give the user a steadier display with fluctuating signals. Rounding is used in addition to the filter function. Rounding causes the display to round to the nearest value according to the rounding selected. This setting affects the last two digits, regardless of decimal point position. On this ProVu model, the valid settings are 1, 2, 5, and 10 (only).

Modbus RTU Serial Communications (SErIAL)


The meter is equipped with serial communications capability as a standard feature using the Modbus RTU Serial Communication Protocol. The meter may be connected to a PC for initial configuration via the onboard micro USB connection. For ongoing digital communications with a computer or other data terminal equipment, an RS-232, or RS-485 option is required; see *Ordering Information* on page 6 for details.

CAUTION

- **DO NOT** connect any equipment other than Precision Digital's expansion modules, cables, or meters to the RJ45 M LINK connector. Otherwise damage will occur to the equipment and the meter.

Note: More detailed instructions are provided with each optional serial communications adapter.


Note: Refer to the ProVu Modbus Register Tables located at www.predig.com for details.

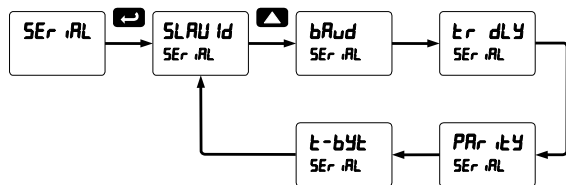

When using more than one meter in a multi-drop mode, each meter must have its own unique Slave ID or meter address. The ID or address may be programmed between 1 and 247. The transmit delay may be set between 0 and 199 ms. The parity can be set to even, odd, or none with 1 or 2 stop bits.

Select Menu (SELEct)

The *Select* menu is used to program the analog output parameters. There are no other selections for this model.

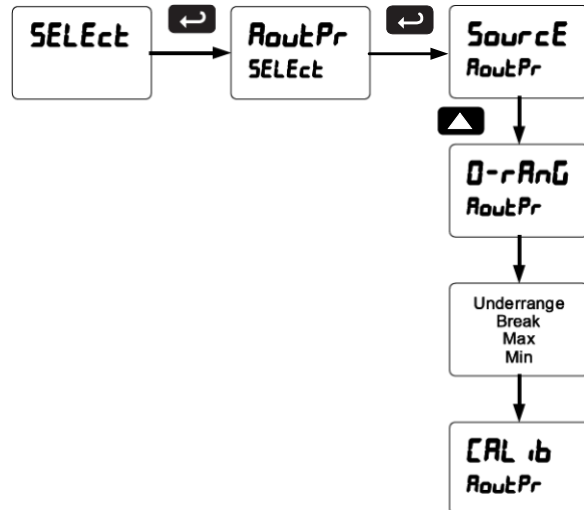


Analog Output Programming (RoutPr)

The *Analog Output Programming* menu is used to program the behavior of the 4-20 mA output. The following parameters and functions are programmed in this menu:

1. Source: Source for generating the 4-20 mA output (e.g. PV - temperature)
2. Overrange: Analog output value with display in overrange condition
3. Underrange: Analog output value with display in underrange condition
4. Break: Analog output value when input break is detected
5. Max: Maximum analog output value allowed regardless of input
6. Min: Minimum analog output value allowed regardless of input
7. Calibrate: Calibrate the internal 4-20 mA source reference used to scale the 4-20 mA output

Analog Output Source

The source for generating the 4-20 mA output may be assigned to the process variable, maximum or minimum value reached by the process, one of the set points, or the Modbus PV input.

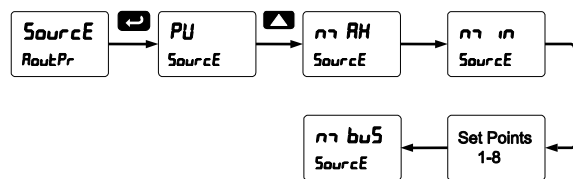

Analog Output Calibration

To perform the analog output calibration, it is recommended to use a milliamp meter with a resolution of at least 0.1 µA to measure the output current. The values saved internally during this procedure are used for scaling the 4-20 mA output in the *Setup* menu.


Analog Output Calibration Procedure

1. Wire the PD7000 4-20 mA output to a current loop that includes a power supply (internal or external 12 to 24 VDC), and the mA input on the digital meter. See *Figure 20. 4-20 mA Output Connections* on page 15 for details.
2. Turn on all devices. Allow for a 15 to 30 minute warm-up.
3. Go to the Advanced Features menu, and navigate to the Analog Output Programming (R0uŁPr)/Calibration (ŁRL ı) menu and press **Enter**.
4. The display will show 4 nŁŁ. The PD7000 mA output should now be close to 4 mA. Press **Enter** and the display will show 04.000. Enter the actual value read by the digital mA meter and press **Enter**.
5. The display will show 20 nŁŁ. The PD7000 mA output should now be close to 20 mA. Press **Enter** and the display will show 20.000. Enter the actual value read by the digital mA meter and press **Enter**.
6. The meter will now calculate the calibration factors and store them.
7. Press **Menu** to exit and return to Run mode.

Programmable Function Keys User Menu (u5Er)

The *User* menu allows the user to assign the front panel function keys F1, F2, and F3, the digital input F4 (a digital input located on the input signal connector), and up to eight additional digital inputs to access most of the menus or to activate certain functions immediately (e.g. reset max & min, hold relay states, etc.). This allows the meter to be greatly customized for use in specialized applications.

Up to eight digital outputs can be assigned to a number of actions and functions executed by the meter (i.e. alarms, relay acknowledgement, reset max, min, or max & min, tare, and reset tare). The digital outputs can be used to trigger external alarms or lights to indicate these specific events.

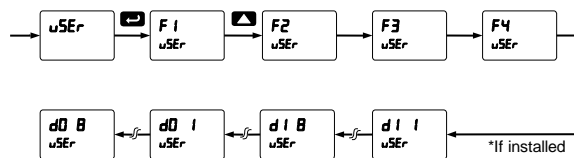

Function Keys & Digital I/O Available Settings

Refer to the following table for descriptions of each available function key or digital I/O setting.

| Display | Description |
|---------|--|
| r5Ł Hı | Reset the stored maximum display value |
| r5Ł Ło | Reset the stored minimum display value |
| r5Ł HŁ | Reset the stored maximum & minimum display values |
| ŁRrE | Capture tare and zero the display |
| r5Ł Łr | Reset captured tare and resume normal operation |
| rELRY | Directly access the relay menu |
| 5EŁ !* | Directly access the set point menu for relay 1 (*through 8) |
| rLY d | Disable all relays until a button assigned to <i>enable relays (rLY E)</i> is pressed |
| rLY E | Enable all relays to function as they have been programmed |
| ı H0Łd | Hold current relay states as they are until a button assigned to <i>enable relays (rLY E)</i> is pressed |
| d H0Łd | Hold the current display value momentarily while the function key or digital input is active. The process value will continue to be calculated in the background. |
| Łnı Hı | Display maximum display value on line 1 |
| Łnı Ło | Display minimum display value on line 1 |
| Łnı HŁ | Display maximum & minimum display values on line 1 |
| Łn2 Hı | Display maximum display value on line 2 |
| Łn2 Ło | Display minimum display value on line 2 |
| Łn2 HŁ | Display maximum & minimum display values on line 2 |
| F 0n !* | Force relay 1 (*through 4) into the on state. This function is used in conjunction with a digital input expansion module to achieve interlock functionality. See page 27 for details about interlock relays. |
| Ł0nŁrŁ | Directly access the control menu |
| d 5RbŁ | Disable the selected function key or digital I/O |
| RcH | Acknowledge all active relays that are in a manual operation mode such as auto-manual or latching |
| rE5EŁ | Directly access the reset menu |
| nE0u | Mimic the menu button functionality (digital inputs only) |
| r ıŁHŁ | Mimic the right arrow/F1 button functionality (digital inputs only) |
| uP | Mimic the up arrow/F2 button functionality (digital inputs only) |
| E0ŁEr | Mimic the enter/F3 button functionality (digital inputs only) |
| RLnŁ !* | Provide indication when alarm 1 (*through 8) has been triggered (digital outputs only) |

Internal Temperature Calibration (ICAL)

The meter is **factory calibrated** prior to shipment to read temperature in degrees Fahrenheit with calibration equipment that is certified to NIST standards.

The Internal Calibration (ICAL) is a function used at the factory to calibrate all the thermocouple and RTD ranges. This procedure should only be used by qualified personnel.

To recalibrate the meter for a specific input and range, refer to *Recalibration of the Meter (ICAL)* on page 31.

Notes:

1. If meter is in operation and it is intended to accept only one input type (e.g. 100 Pt), recalibration of other inputs is not necessary.
2. Allow the meter to warm up for at least 30 minutes before performing the calibration procedure.
3. Use the *Recalibration of the Meter (ICAL)* procedure on page 31.


The *Internal calibration* menu is part of the *Advanced Features* menu and is described in the following pages. This procedure should only be used by qualified personnel.

Note: Most users should not require the use of the Internal Calibration procedure. The T CAL procedure should be used instead of the ICAL procedure.

Thermocouple Input Internal Calibration (ICAL)


1. Set the Type selector switch in the TC position and using copper wire connect a precision mV calibrator to the input.
2. In the *Setup* menu select the input: TC – Type J.
3. Press and hold the Menu button for three seconds to access the advanced features of the meter.
4. Press the Up arrow button to scroll to the *Internal calibration* menu (ICAL) and press Enter.
5. The meter displays either current calibration (REF). Press Enter to start the calibration process.
6. Measure the room temperature in degrees Celsius using a reliable reference, enter the room temperature (e.g. 25.0), and press Enter.
7. The meter displays 0.000 mV, apply an input equal to 0.000 mV and press Enter. The display flashes while accepting the 0 mV input; press Enter again when the display stops flashing.
8. The meter displays 100.000 mV, apply an input equal to 100.000 mV and press Enter. The display flashes while accepting the 100 mV input; press Enter again when the display stops flashing.
9. Apply 0 mV, the meter should read room temperature.

10. This completes the calibration of all the thermocouple ranges.

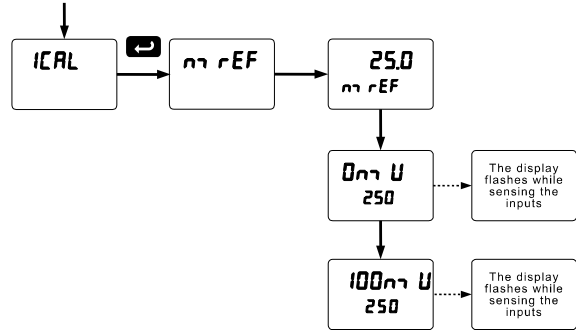

RTD Input Internal Calibration (ICAL)

1. Set the Type selector switch in the RTD position and the Range switch in the 10 position. Using 3 wires connect a precision calibrator resistance output to the meter.
2. In the *Setup* menu select the input: RTD – 100 Pt – A385.
3. Access the *Advanced Features* menu and scroll to the *ICAL* menu and press Enter.
4. The meter displays the message (10 Lo). Apply 9.035 ohm and press Enter. The display flashes for a moment while the meter is accepting the low input signal for the 10-ohm RTD. After the display stops flashing, press Enter again.
5. The meter displays the message (10 Hi). Apply 18.032 ohm and press Enter. The display flashes for a moment while the meter is accepting the high input signal for the 10-ohm RTD. After the display stops flashing, press Enter again.
6. The meter displays the message (100 Lo). **Do NOT press Enter.**
7. Move the Range selector switch to the 100 position. Apply 100 ohm and press Enter. The display flashes for a moment while the meter is accepting the low input signal for the 100-ohm RTD.
8. The meter displays the message (100 Hi). Apply 320.12 ohm and press Enter. The display flashes for a moment while the meter is accepting the high input signal for the 100-ohm RTD.
9. At the end of the calibration process the meter should read 1148.0F with the 320.12-ohm input applied.
10. This completes the calibration of all the RTD ranges.

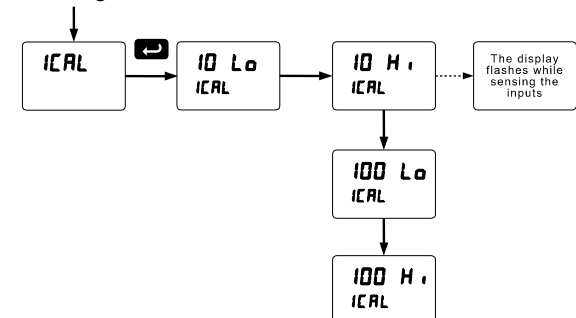

Meter Operation

The meter is capable of accepting a variety of thermocouples and RTDs.

The dual-line display can be customized by the user to operate in such a way as to satisfy a specific application. Typically, display line 1 is used for the process variable; while line 2 is used engineering units, custom legend, or set point indication.

Additionally, the meter can be set up to display the thermocouple or RTD input on line 1 and the Modbus input on line 2. The relays and analog output can be programmed to operate from the Modbus PV input.

Front Panel Buttons Operation

| Button Symbol | Description |
|---------------|---|
| | Press to enter or exit Programming Mode, view settings, or exit max/min readings |
| | Press to reset max/min readings or other parameter/function assigned through the <i>User</i> menu |
| | Press to display max/min readings or other parameter/function assigned through the <i>User</i> menu |
| | Press to acknowledge relays or other parameters/function assigned through the <i>User</i> menu |

Function Keys Operation

During operation, the programmable function keys operate according to the way they have been programmed in the *Advanced Features – User* menu. See *Programmable Function Keys User Menu (u5Er)* on page 33 for details.

The table above shows the factory default settings for F1, F2, and F3.

F4 Operation

A digital input, F4, is standard on the meter. This digital input is programmed identically to function keys F1, F2, and F3. The input is triggered with a contact closure to COM, or with an active low signal. During operation, F4 operates according to the way it has been programmed in the *Advanced Features – User* menu. See *Programmable Function Keys User Menu (u5Er)* on page 33 for details.

Maximum/Minimum Readings

The max & min readings (peak & valley) reached by the process can be displayed either continuously or momentary:

1. Display briefly by assigning to the F1-F3 function keys or to the digital inputs in the *User* menu.
2. Display continuously by assigning either display to max/min through the *Display* menu.


Any of the F1-F3 function keys (buttons) and the digital inputs can be programmed to reset the max & min readings. The meters are set at the factory to display the max reading by pressing the Up arrow/F2 button and to use the Right arrow/F1 button to access the *Reset* menu.

To display max reading using function key with factory defaults:

1. Press Up arrow/F2 button to display maximum reading since the last reset/power-up.
2. To reset max/min press Right arrow/F1 button to access the *Reset* menu. The max & min displays are reset to actual values.
3. Press Menu to exit max/min display reading.

To display max/min readings continuously:

Assign either display to Max (d H_i), Min (d L_o), or toggle between Max and Min (d HL) every 10 seconds.

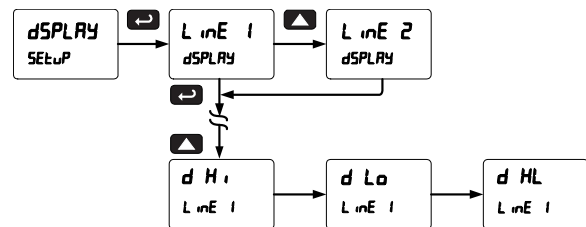

Troubleshooting

The rugged design and the user-friendly interface of the meter should make it unusual for the installer or operator to refer to this section of the manual. However, due to the many features and functions of the meter, it's possible that the setup of the meter does not agree with what an operator expects to see. If the meter is not working as expected, refer to the *Diagnostics* menu and recommendations below.

Diagnostics Menu (d ,RŁ)

The *Diagnostics* menu is located in the *Advanced Features* menu, to access *Diagnostics* menu see *Advanced Features Menu* on page 30.

This menu allows the user to test the functionality of all the meter LEDs, check the meter's software and version information, and erase the MeterView Pro software installation files from the meter. Press the Enter button to view the settings and the Menu button to exit at any time.

For a description of the diagnostic messages, see *Advanced Features Menu & Display Messages* on page 30.

Determining Software Version

To determine the software version of a meter:


1. Go to the *Diagnostics* menu (d ,RŁ) and press Enter button.
2. Press Up arrow button and scroll to Information menu (i n F a).
3. Press Enter to access the software number (5 F Ł) and version (Ł E r) information. Write down the information as it is displayed. Continue pressing Enter until all the information is displayed.
4. The meter returns to Run Mode after displaying all the settings.

Reset Meter to Factory Defaults

When the parameters have been changed in a way that is difficult to determine what's happening, it might be better to start the setup process from the factory defaults.

Instructions to load factory defaults:

1. Enter the *Advanced Features* menu. See *Advanced Features Menu*, page 30.
2. Press Up arrow to go to *Diagnostics* (d ,RŁ) menu
3. Press and hold Right arrow for three seconds, press Enter when display flashes reset. Note: If Enter is not pressed within three seconds, the display returns to the *Diagnostics* menu.
4. The meter goes through an initialization sequence (similar as on power-up) and loads the factory default settings.

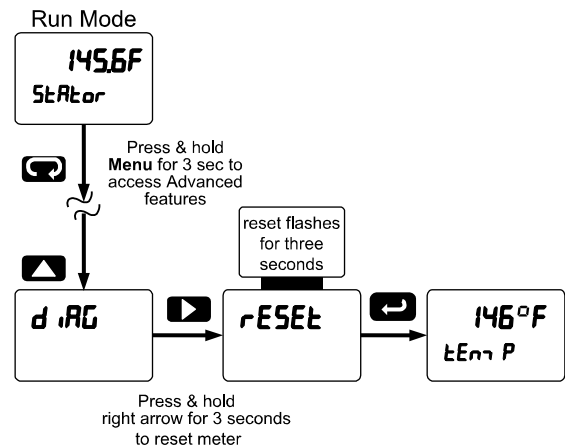

Factory Defaults & User Settings

The following table shows the factory setting for most of the programmable parameters on the meter.

| Parameter | Display | Default Setting |
|---------------------|-----------|-----------------|
| Input type | inPut | Type J TC |
| Temp scale | F or C | °F |
| Adjust | Adjust | 0.0 |
| RTD total | rtd tot | 1 |
| Filter | Filter | 70 |
| Bypass | bypass | 0.2 |
| Round | round | 1 |
| Decimal point | decimal | No decimal |
| Display line 1 | line 1 | PV: Temperature |
| Display line 2 | line 2 | Eng units: Temp |
| Display intensity | intensity | 8 |
| Relay 1 action | rel 1 | Automatic |
| Relay 1 set point | set 1 | 100 |
| Relay 1 reset point | res 1 | 50 |
| Relay 2 action | rel 2 | Automatic |
| Relay 2 set point | set 2 | 200 |
| Relay 2 reset point | res 2 | 150 |
| Relay 3 action | rel 3 | Automatic |
| Relay 3 set point | set 3 | 300 |
| Relay 3 reset point | res 3 | 250 |
| Relay 4 action | rel 4 | Automatic |
| Relay 4 set point | set 4 | 400 |
| Relay 4 reset point | res 4 | 350 |
| Fail-safe relay 1 | fs 1 | Off |
| Fail-safe relay 2 | fs 2 | Off |
| Fail-safe relay 3 | fs 3 | Off |
| Fail-safe relay 4 | fs 4 | Off |
| On delay relay 1 | on 1 | 0.0 sec |
| Off delay relay 1 | off 1 | 0.0 sec |
| On delay relay 2 | on 2 | 0.0 sec |
| Off delay relay 2 | off 2 | 0.0 sec |
| On delay relay 3 | on 3 | 0.0 sec |
| Off delay relay 3 | off 3 | 0.0 sec |
| On delay relay 4 | on 4 | 0.0 sec |

| Parameter | Display | Default Setting |
|----------------------|----------|--------------------|
| Off delay relay 4 | off 4 | 0.0 sec |
| Input break relay 1 | inbrk 1 | Ignore |
| Input break relay 2 | inbrk 2 | Ignore |
| Input break relay 3 | inbrk 3 | Ignore |
| Input break relay 4 | inbrk 4 | Ignore |
| Display 1 analog out | dis 1 | 0.0 |
| Output 1 value | out 1 | 4.000 mA |
| Display 2 analog out | dis 2 | 2000.0 |
| Output 2 value | out 2 | 20.000 mA |
| Source analog output | source | Process Variable |
| Overrange output | orr | 21.000 mA |
| Underrange output | urr | 3.000 mA |
| Input break output | inbrk | 1.000 mA |
| Maximum output | max | 23.000 mA |
| Minimum output | min | 1.000 mA |
| Slave ID | slave id | 247 |
| Baud rate | baud | 9600 |
| Transmit delay | tr delay | 10 ms |
| Parity | parity | Even |
| Byte-to-byte timeout | byte | 010 (0.1 sec) |
| F1 function key | F 1 | Reset max & min |
| F2 function key | F 2 | Line 1: Max (Hi) |
| F3 function key | F 3 | Acknowledge relays |
| F4 function | F 4 | Acknowledge relays |
| Digital input 1 | di 1 | Menu |
| Digital input 2 | di 2 | Right arrow |
| Digital input 3 | di 3 | Up arrow |
| Digital input 4 | di 4 | Enter |
| Digital output 1 | do 1 | Alarm 1 |
| Digital output 2 | do 2 | Alarm 2 |
| Digital output 3 | do 3 | Alarm 3 |
| Digital output 4 | do 4 | Alarm 4 |
| Password 1 | pass 1 | 000000 (unlocked) |
| Password 2 | pass 2 | 000000 (unlocked) |
| Password 3 | pass 3 | 000000 (unlocked) |

Troubleshooting Tips

This meter is a highly sophisticated instrument with an extensive list of features and capabilities. If the front panel buttons are used to program the meter, it may be a difficult task to keep everything straight. That is why we strongly recommend the use of the free [MeterView Pro](#) software for all programming activities. A cable is provided with the meter for programming with MeterView Pro software.

If you have programmed the meter with the front panel buttons and it is not working as intended, try re-programming the meter using MeterView Pro software.

| Symptom | Check/Action |
|---|--|
| No display at all | Check power at power connector |
| Not able to change setup or programming, LoCd is displayed | Meter is password-protected, enter correct six-digit password to unlock |
| Meter displays error message during calibration (Error) | Check: 1. Signal connections 2. Type and range selector switches 3. Input selected in <i>Setup</i> menu |
| Meter displays 1. 99999 2. -9999 | Check: 1. Input selected in <i>Setup</i> menu 2. Corresponding signal at Signal connector |
| Display is unstable | Check: 1. Input signal stability and value 2. Filter and bypass values (increase) |
| Display response is too slow | Check filter and bypass values |
| Display reading is not accurate | Check: 1. TC wire type 2. Input selection in <i>Setup</i> menu |
| Display does not respond to input changes, reading a fixed number | Check: 1. Display assignment, it might be displaying max, min, or set point. |
| Display alternates between 1. H i and a number 2. Lo and a number | Press Menu to exit max/min display readings. |
| Relay operation is reversed | Check: 1. Fail-safe in <i>Setup</i> menu 2. Wiring of relay contacts |
| Relay and status LED do not respond to signal | Check: 1. Relay action in <i>Setup</i> menu 2. Set and reset points |
| Flashing relay status LEDs | Relays in manual control mode or relay interlock switches opened. |
| Meter not communicating with application programs | Check: 1. Serial adapter and cable 2. Serial settings 3. Meter address and baud rate |
| If the display locks up or the meter does not respond at all | Cycle the power to reboot the microprocessor. |
| Other symptoms not described above | Call Technical Support for assistance. |

Note: Certain sequences of events can cause unexpected results. To solve these issues, it is best to start fresh from factory defaults and use the manual as a step by step programming guide, rather than a random approach to programming. To reset the meter to factory defaults, see Reset Meter to Factory Defaults on page 36. In addition, for best results, we recommend using the free MeterView Pro software for all programming needs.



EU Declaration of Conformity

Issued in accordance with ISO/IEC 17050-1:2004.

We,

Precision Digital Corporation
233 South Street
Hopkinton, MA 01748 USA

as the manufacturer, declare under our sole responsibility that the product(s),

Model PD7000 Series Temperature Panel Meter

to which this declaration relates, is in conformity with the European Union Directives shown below:

| | |
|-------------------|------------------------------|
| 2014/35/EU | Low Voltage Directive |
| 2014/30/EU | EMC Directive |
| 2011/65/EU | RoHS Directive |

This conformity is based on compliance with the application of harmonized or applicable technical standards and, when applicable or required, a European Union notified body certification.

Standards:

EN 55022:2003
EN 61000-6-2:2001
EN 61010-1:2001
EN 61326:2006

The standards EN 55022:2003, EN 61000-6-2:2001, EN 61010-1:2001, and EN 61326:2006 are no longer harmonized. The requirements of these standards have been checked against the harmonized standards EN 55022:2010, EN 61000-6-2:2005, EN 61010-1:2010, and EN 61326:2013 and there were no major technical changes affecting the latest technical knowledge for the products listed above.

Product Markings:



Signed for and on behalf of Precision Digital Corporation:

A handwritten signature in cursive script, reading "Jeffrey Peters", written over a horizontal line.

Name: Jeffrey Peters
Company: Precision Digital Corporation
Title: President
Date: 04/20/2016

Document No: DoC PD7000 {042016}

Contact Precision Digital

Technical Support

Call: (800) 610-5239 or (508) 655-7300

Fax: (508) 655-8990

Email: support@predig.com

Sales Support

Call: (800) 343-1001 or (508) 655-7300

Fax: (508) 655-8990

Email: sales@predig.com

Place Orders

Email: orders@predig.com

For the latest version of this manual please visit

www.predig.com

PRECISION DIGITAL CORPORATION

233 South Street • Hopkinton MA 01748 USA

Tel (800) 343-1001 • Fax (508) 655-8990

www.predig.com

