

# Passive Sensor Selection Guide

Thread Size	Part Number	Output * Guarantee Voltage (P-P)	Termination	Thread Length (in)	Sensor Length (in)	Agency Approval	Temp Rating (deg C)	Page
3/4-20	70085-1010-405	9.4	Cable	2.75	4	X	-55 to 220	19
3/4-20	70085-1010-413	13.4	Wires	1.5	2.75	X	-65 to 95	18
3/4-20	70085-1010-005	13.4	Wires	1.875	3.125	X	-65 to 95	18
3/4-20	70085-1010-541	13.4	Cable	1.88	3.13	X	-20 to 220	19
3/4-20	70085-1010-542	13.4	Cable	2.75	4	X	-20 to 220	19
3/4-20	70085-1010-327	13.4	Wires	2.75	4	X	-65 to 95	18
3/4-20	70085-1010-540	13.4	Cable	4	5.25	X	-20 to 220	19
3/4-20	70085-1010-328	13.4	Wires	4	5.25	X	-65 to 95	18
3/4-20	70085-1010-543	13.4	Cable	6	7.25	X	-20 to 220	19
3/4-20	70085-1010-414	13.4	Wires	6	7.25	X	-65 to 95	18
3/4-20	70085-3030-222	13.4	Cable	2.75	4	X	-65 to 95	20
M16 x 1.5	70085-1010-425	4.9	Connector	3	4.125		-55 to 107	12
M16 x 1.5	70085-3030-235	13.4	Cable	1.5	2.75	X	-65 to 95	20
M16 x 1.5	70085-3030-237	13.4	Cable	1.5	2.75	X	-65 to 95	20
5/8-18	70084-1713-111	13.4	Connector	1.125	2.5		-40 to 150	11
5/8-18	70085-1010-001	3.4	Connector	1.125	2.25		-55 to 107	8
5/8-18	70085-1010-003	3.4	Connector	2.625	3.75		-55 to 107	8
5/8-18	70085-1010-018	3.4	Connector	3.625	4.75		-55 to 107	8
5/8-18	70085-1010-118	3.4	Connector	5	6.125		-55 to 107	8
5/8-18	70085-1010-002	12.9	Connector	1.125	2.25		-55 to 107	8
5/8-18	70085-1010-175	12.9	Connector	2.625	3.75		-55 to 107	8
5/8-18	70085-1010-026	12.9	Connector	3.625	4.75		-55 to 107	8
5/8-18	70085-1010-408	12.9	Connector	5	6.125		-55 to 107	8
5/8-18	70085-1010-028	21.5	Connector	1.437	2.53		-70 to 107	9
5/8-18	70085-1010-004	4.3	Wires	1.125	2.125		-70 to 107	9
5/8-18	70085-1010-469	4.3	Wires	2.750	3.75		-70 to 107	9
5/8-18	70085-1010-131	15.1	Cable	1.687	1.687		-55 to 107	10
5/8-18	70085-1010-214	15.1	Cable	2.937	2.937		-55 to 107	10
5/8-18	70085-1010-078	3.4	Wires	1.812	1.812		-55 to 107	10
5/8-18	70085-1010-137	3.4	Wires	2.937	2.937		-55 to 107	10
5/8-18	70085-1010-220	12.8	Wires	2.937	2.937		-55 to 107	11
5/8-18	70085-1010-421	4.9	Connector	2.475	3.6		-55 to 107	12
5/8-18	70085-1010-424	4.9	Connector	4.493	5.618		-55 to 107	12
5/8-18	70085-1010-081	13.4	Wires	1.5	2.75	X	-65 to 95	18
5/8-18	70085-1010-544	13.4	Cable	1.88	3.13	X	-20 to 220	19
5/8-18	70085-1010-411	13.4	Wires	1.875	3.125	X	-65 to 95	18
5/8-18	70085-1010-329	13.4	Wires	2.75	4	X	-65 to 95	18
5/8-18	70085-1010-330	13.4	Wires	4	5.25	X	-65 to 95	18
5/8-18	70085-1010-412	13.4	Wires	6	7.25	X	-65 to 95	18
5/8-18	70085-1010-404	13.4	Cable	1.5	2.75	X	-20 to 220	19
5/8-18	70085-1010-406	13.4	Cable	2.75	4	X	-20 to 220	19
5/8-18	70085-1010-417	13.4	Cable	4	5.25	X	-20 to 220	19
5/8-18	70085-1010-420	13.4	Cable	6	7.25	X	-20 to 220	19
5/8-18	70085-1010-403	9.4	Cable	1.5	2.75	X	-55 to 220	19
5/8-18	70085-1010-415	9.4	Cable	4	5.25	X	-55 to 220	19
5/8-18	70085-1010-416	9.4	Cable	6	7.25	X	-55 to 220	19
5/8-18	70085-3030-111	13.4	Cable	1.5	2.75	X	-65 to 95	20
5/8-18	70085-3030-112	13.4	Cable	2.75	4	X	-65 to 95	20
5/8-18	70085-3030-113	13.4	Cable	4	5.25	X	-65 to 95	20
5/8-18	70085-3030-114	13.4	Cable	6	7.25	X	-65 to 95	20
5/8-18	70085-3030-211	9.4	Cable	1.5	2.75	X	-65 to 95	20
5/8-18	70085-3030-212	13.4	Cable	2.75	4	X	-65 to 95	20
5/8-18	70085-3030-213	9.4	Cable	4	5.25	X	-65 to 95	20
5/8-18	70085-3030-214	9.4	Cable	6	7.25	X	-65 to 95	20
5/8-18	70085-8080-003	12.8	Wires	1.812	1.812		-55 to 107	11

\* Output is based on .030" air gap at 500 IPS

# Passive Sensor Selection Guide

Thread Size	Part Number	Output * Guarentee Voltage (P-P)	Termination	Thread Length (in)	Sensor Length (in)	Agency Approval	Temp Rating (deg C)	Page
3/8-24	70085-1010-007	1.6	Wires	0.812	1.252		-55 to 107	13
3/8-24	70085-1010-056	1.6	Wires	3.625	4.065		-55 to 107	13
3/8-24	70085-1010-086	3.6	Wires	0.812	1.252		-55 to 107	13
3/8-24	70085-1010-355	3.6	Wires	0.812	1.252		-55 to 107	13
3/8-24	70085-1010-041	2	Wires	0.812	1.252		-73 to 232	14
3/8-24	70085-1010-428	2	Wires	1.5	1.94		-73 to 232	14
3/8-24	70085-1010-458	2	Wires	3.625	4.065		-73 to 232	14
3/8-24	70085-1010-174	3.6	Wires	0.812	1.252		-65 to 220	14
3/8-24	70085-8080-001	4.2	Wires	1.5	1.5		-55 to 107	15
.375 no thd	70085-1010-314	4.2	Cable	1.375	1.375		-30 to 85	15
.375 no thd	70085-8080-004	4.2	Cable	2.5	2.5		-30 to 85	15
1/4-40	70085-1010-024	0.4	Wires	0.687	1		-73 to 232	16
1/4-40	70085-1010-472	0.4	Wires	0.687	1.187		-73 to 232	16
1/4-40	70085-1010-227	0.4	Wires	1.687	2		-73 to 232	16
10-32	70085-1010-037	0.6	Wires	0.5	0.5		-55 to 107	17
10-32	70085-1010-299	0.6	Wires	1.25	1.25		-55 to 107	17
10-32	70085-1010-182	0.3	Wires	0.5	0.5		-73 to 232	17
10.32	70085-1010-289	0.3	Wires	1.25	1.25		-73 to 232	17

\* Output is based on .030" air gap at 500 IPS

## Magnetic Sensor Selection

The following information is supplied for assistance in selecting the proper sensors for your particular applications. One of the fundamental questions to be answered is, "Will there be enough sensor output voltage at the lowest operating speed?"

The sensor output voltage depends on:

- Surface Speed - speed target passes pole piece
- Gap - distance between target and pole piece
- Target Size - geometric relationship of pole piece and target
- Load Impedance - connected to sensor

The surface speed of a gear depends upon its diameter and RPM. Surface speed is expressed in terms of inches per second (IPS).


$$\text{Surface Speed (IPS)} = \frac{\text{RPM} \times \text{Outside Dia. (in.)} \times \pi}{60}$$

There is an optimum pitch (or tooth size) to obtain the highest possible output from a sensor, but this is seldom necessary. Figure 4 illustrates the relationship of tooth size and spacing for optimum magnetic sensor output. Using a fine tooth gear, relative to a large pole piece diameter sensor, results in a lower generated voltage because the flux also passes into adjacent teeth, resulting in a lower total flux variation.

The relationship between pole piece diameter and gear pitch and its effect on the output of a sensor is described in Table A.

**Table A:** Relative Output Vs. Gear Pitch

Pole Piece Dia. (in)	Gear Pitch						
	8	12	16	20	24	32	48
.187	1.00	0.83	0.33	0.16	—	—	—
.106	1.41	1.41	1.27	1.00	0.70	0.28	0.07
.093	1.25	1.25	1.25	1.00	0.75	0.37	0.12
.062	0.95	1.07	1.00	1.00	0.92	0.90	0.36
.040	1.00	1.00	1.00	1.00	1.00	0.90	0.60

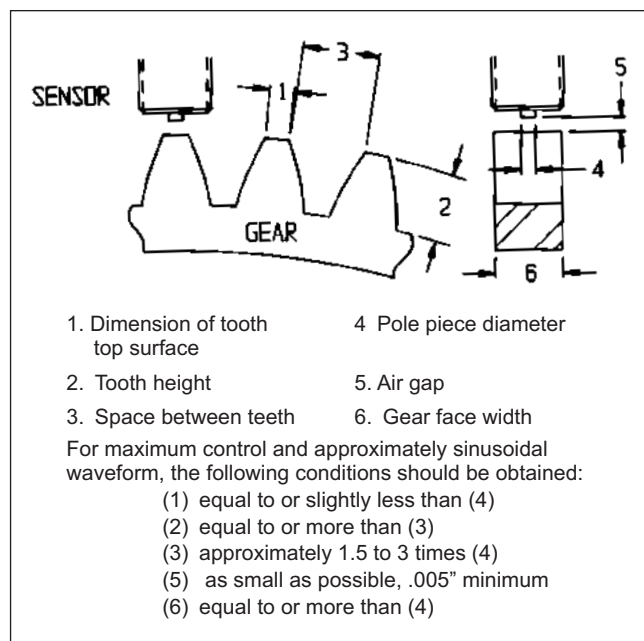

**Figure 4:** Sensor output as a function of gear tooth size.

The load impedance, with relation to the internal impedance of the sensor, dictates the amount of sensor output voltage that will be seen by that load. Magnetic sensors are designed with the lowest practical impedance consistent with providing maximum output. The load impedance should be high in relation to the impedance of the sensor to minimize the voltage drop across the coil and to deliver the maximum output to the load.

Most of the output voltages listed in this catalog are based on a load impedance of 100k ohms. To use a generality, the load impedance should be 10 times that of the sensor.

In order to assist you in selecting your sensor, **AI-Tek Instruments** has developed an output vs. speed curve for each sensor family. By looking at the application extremes of highest speed/lowest gap and lowest speed/highest gap, the full variation of sensor output can easily be determined. We also specify each family in two ways: **Standard** - minimum output voltage at 1000 IPS, 0.005 in. gap. **Guarantee Point** - minimum output voltage at 500 IPS, 0.030 in. gap. Sensors with .187" dia. pole piece are tested with an 8 D.P. gear, 100k ohms load; .106" dia. & smaller pole piece sensors are tested with a 20 D.P. gear, 100k ohms load. Sensors with connectors also use a 250 pf capacitor shunted across the load.